

# Digital Scale

## TITAN-Compact

### INSTRUCTION MANUAL

SK-1000WP  
SK-2000WP  
SK-5000WP  
SK-5001WP  
SK-10KWP  
SK-20KWP  
SK-30KWP





## COMPLIANCE

### □ Compliance with FCC Rules

Please note that this equipment generates, uses and can radiate radio frequency energy. This equipment has been tested and has been found to comply with the limits of Class A digital devices pursuant to Part 15 of FCC rules. These rules are designed to provide reasonable protection against interference when equipment is operated in a commercial environment. If this unit is operated in a residential area, it may cause some interference and under these circumstances the user would be required to take, at his own expense, whatever measures are necessary to eliminate the interference. (FCC = Federal Communications Commission in the U.S.A.)



## SAFETY PRECAUTIONS

All safety messages are identified by the following, “**WARNING**” or “**CAUTION**”, of ANSI Z535.4 (American National Standard Institute: Product Safety Signs and Labels). The meanings are as follows:

<b>⚠ WARNING</b>	A potentially hazardous situation which, if not avoided, could result in death or serious injury.
<b>⚠ CAUTION</b>	A potentially hazardous situation which, if not avoided, may result in minor or moderate injury.

- This manual is subject to change without notice at any time to improve the product.
- Product specifications are subject to change without any obligation on the part of the manufacturer.
- When using the SK-WP, the following safety precautions should always be followed.

### **⚠ WARNING**

**Use only the specified AC adapter for the scale. Other adapters may cause damage. (AC adapter is optional.)**

**Internal service or adjustment to this product should be performed by a qualified person.**

### **⚠ CAUTION**

Avoid installing the scale in direct sunlight, which may cause discoloration or malfunctions.

Do not mix battery types, or new and old batteries. Replace with all new batteries at the same time. If the scale is not to be used for a long period of time, remove all batteries from the battery compartment to avoid leakage.

Avoid overloading to the scale.



Avoid using the weighing platform to move the scale, as that could cause damage to the scale.

Avoid chemical solvents. Clean the scale with water.


When the scale is used with an AC adapter, the scale does not conform to IP65 protection.



## PARTS DESCRIPTION

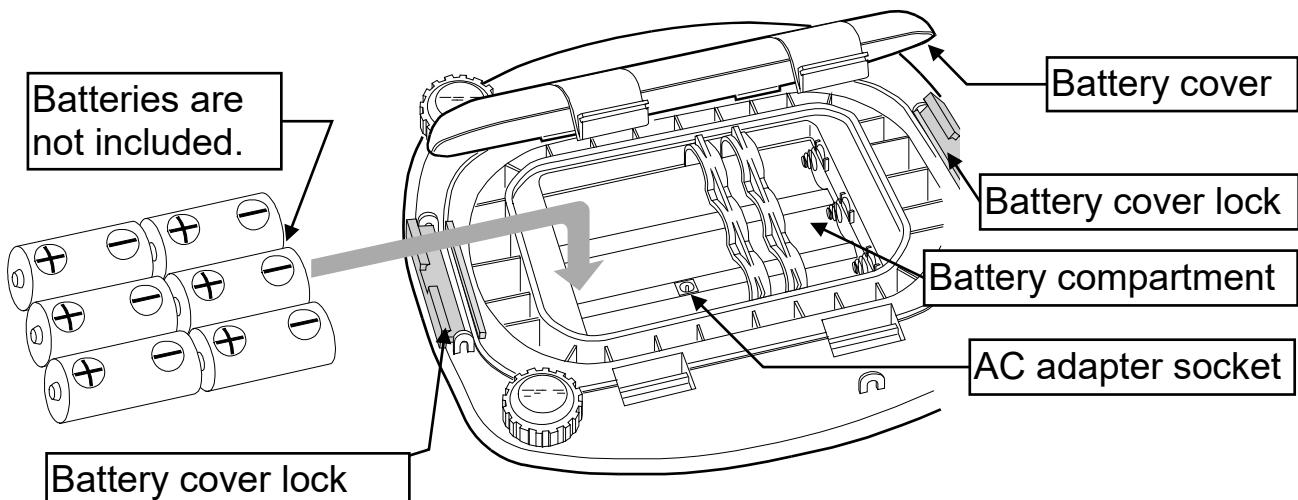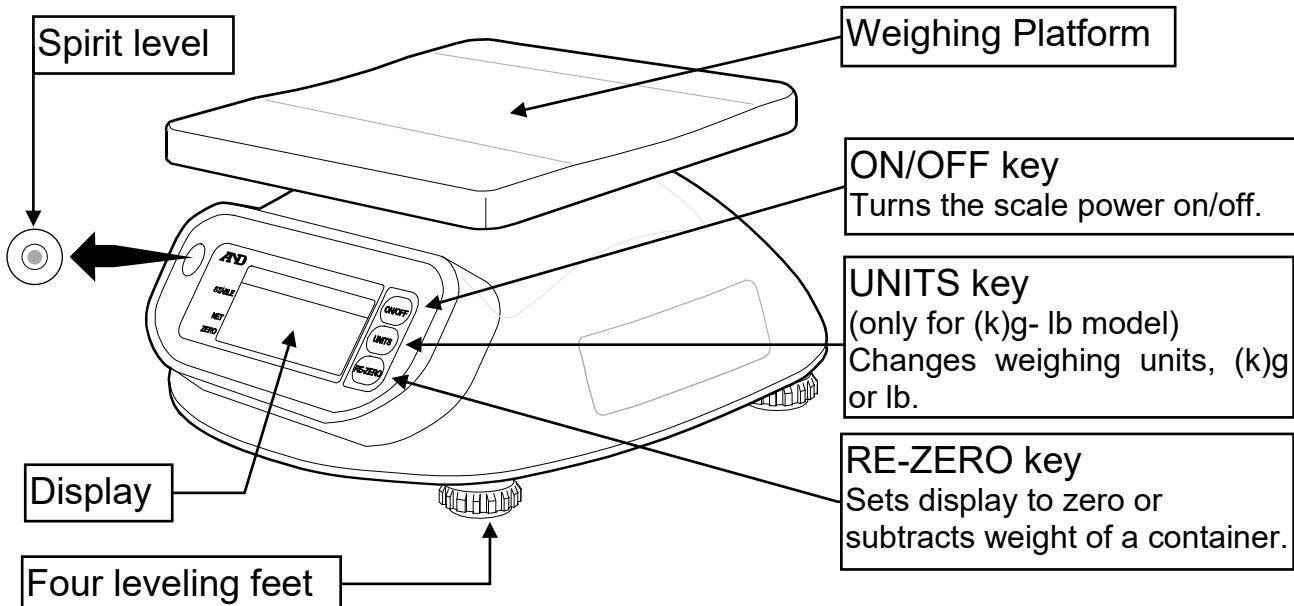

## DISPLAY

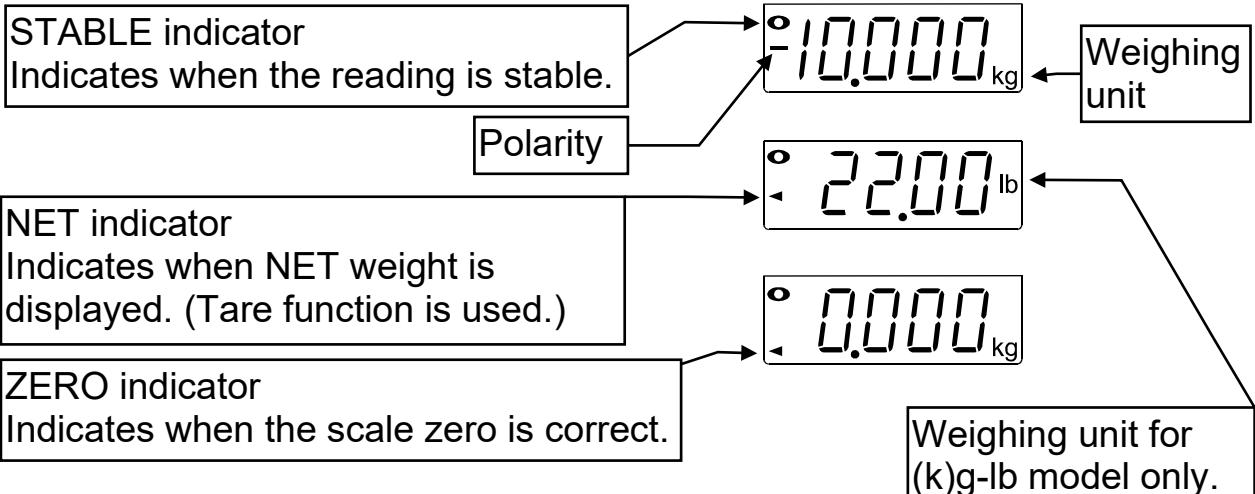



## PREPARATION



### Installing Batteries / Connecting the AC Adapter

#### Installing Batteries

**⚠ CAUTION** When replacing batteries, be careful not to apply too much force to the weighing platform. An excessive force could damage the scale.


Unlock and remove the battery cover.  
(See illustration at the right)

Insert six new batteries (R20P / LR20 / D size) into the battery compartment, taking extreme care to that the plus and minus polarities are observed.

Be sure to install and lock the battery cover after installing the batteries.

New six batteries. (R20P/ LR20/ D size)


Stop up with the rubber cap

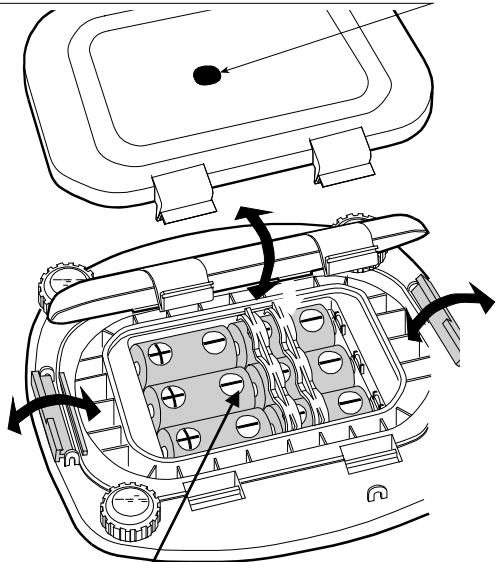

#### AC Adapter (Optional)

**⚠ CAUTION** When using an AC adapter, the scale doesn't comply with IP65. The AC input requirement could be 100, 120, 220, 230 or 240 volts (50/60Hz) depending on the area where used, so please verify that the adapter is the correct type.

Plug the AC adapter to the AC adapter socket inside the battery compartment.

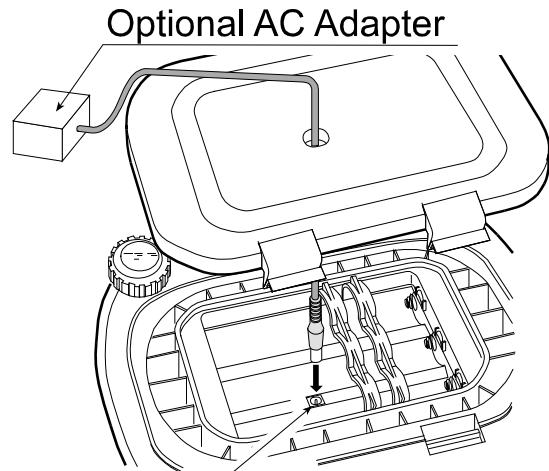

## Setting up the Scale

**⚠ CAUTION** Avoid installing the scale in direct sunlight, that may cause discoloration or malfunctions. Place your SK-WP on a firm weighing table so that the scale is level. The scale will not perform accurately when it is not level.

Place the scale on a firm surface and adjust the feet to level the scale, while using the spirit level, for accurate weighing.



## WEIGHING



### Before Weighing

#### Automatic Power-Off Function.

If the scale is left ON and the stable indicator is displayed, the automatic power-off function turns the power off after approximately five minutes (factory setting). To disable or enable the function, press the [ON/OFF] key while pressing the [RE-ZERO] key. The scale stores this setting. To verify this, press both the [RE-ZERO] and [UNITS] keys while in the weighing mode. (See "CALIBRATION" about the [UNITS] key.)

**PoFF 0** Function disabled

**PoFF 1** Function enabled

#### Error Message

E
-----
Lb

Overload

The scale zero is out of range

Low battery

#### Calibration May be Required Before Weighing

Read "CALIBRATION" first and if necessary, calibrate your scale for accurate weighing.



## Weighing Procedures

#### 1. Turn on the scale.

Press the [ON/OFF] key to turn on the scale. Then the scale displays all segments for a few seconds and then **0.0** will be displayed.

#### 2. Start weighing

##### If you do not use a container for weighing,

Press the [RE-ZERO] key to display **0.0**. Verify the reading is **0.0**. Place objects on the weighing platform to weigh. When the reading becomes stable, the stable indicator **●** is displayed.

##### If you use a container for weighing,

Place an empty container on the platform.

Wait for the stable indicator **●** to be displayed and press the [RE-ZERO] key. Place the objects to be weighed in the container. When the reading becomes stable, the stable indicator **●** is displayed.

#### Select the weighing unit, --- Only for the "(k)g-lb" model---

If you use the (k)g-lb model, press the [UNITS] key to select weighing with either (k)g or lb as the unit.

Normally scales power up in lb when shipped from the factory. To power up in (k)g, turn the scale off. Press and hold the [UNITS] key, then press the [ON/OFF] key. The scale will start with (k)g. To return to the original setting, repeat this instruction.



## CALIBRATION



### When to Calibrate

Calibration may be required when the scale is initially installed, if it is moved a substantial distance, or in accordance with local regulations. This is necessary because the weight of a mass in one location is not necessarily the same in another location. Also, with time and use, mechanical deviations can occur.


#### The Position of the [UNITS] key for the Calibration

The (kg) model has no [UNITS] key, but the key for the calibration is located under the overlay.

ON/OFF key

Location of the [UNITS] key

RE-ZERO key

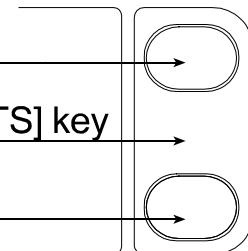

### Calibration Using a Calibration Weight

Calibrate the scale with the following calibration weight.

SK-1000WP:  $1000g \pm 0.1g$

SK-2000WP:  $2000g \pm 0.2g$

SK-5000WP:  $5000g \pm 0.5g$

SK-5001WP:  $5000g \pm 0.5g$

SK-10KWP:  $10kg \pm 1g$

SK-20KWP:  $20kg \pm 2g$

SK-30KWP:  $30kg \pm 2g$

#### 1. Enter calibration mode.

Press the [ON/OFF] key to turn the power off.

While pressing both the [RE-ZERO] and [UNITS] keys, press the [ON/OFF] key. Then, **[CAL]** will be displayed.

#### 2. Zero calibration

Press the [RE-ZERO] key to calibrate zero. **[CAL 0]** will be displayed.

When you have proceeded to the display other than **[CAL 0]**, press the [ON/OFF] key to turn the power off and start over again.

Wait for the stable indicator **O** to be displayed and press the [RE-ZERO] key. **[CAL F]** will be displayed in a few seconds. If the zero calibration only is to be done, press the [UNITS] key. The scale will show **End** and automatically return to the weighing mode.

#### 3. Span calibration

Place the weight at the center of the platform for accurate calibration. Wait for the stable indicator **O** to be displayed and press the [RE-ZERO] key. The scale will show **End** and the scale will automatically return to the weighing mode.



## Calibration by Gravity Compensation

If you have calibration weights at the capacity of the scale, you can calibrate the scale with the weights instead of compensating for the gravity acceleration.

The scale is calibrated at 9.798 m/sec<sup>2</sup> at the factory. If the gravity acceleration at your location is not the same, calibrate the scale by compensating for the gravity acceleration. (See “The Value of Gravity at Various Locations” and “World Map” and find your location value.)

### 1. Enter calibration mode.

Press the [ON/OFF] key to turn the power off. While pressing both the [RE-ZERO] and [UNITS] keys, press the [ON/OFF] key. Then, **[RL]** will be displayed.

### 2. Select a digit to be changed.

Press the [UNITS] key. The previously set value, for example **9798**, will be displayed. A digit after the comma “,” will be changed by pressing the [RE-ZERO] key. Press the [UNITS] key to move the comma “,” and select a digit to be changed.

### 3. Set the new value.

Change the value of the gravity acceleration using the [RE-ZERO] and [UNITS] keys.

### 4. Save the value in memory.

Press and hold the [UNITS] key until **[End]** is displayed. The scale will automatically return to the weighing mode.




## SPECIFICATIONS

Model	SK-1000WP	SK-2000WP	SK-5000WP	SK-5001WP	SK-10KWP	SK-20KWP	SK-30KWP
Capacity	1000 g 2.2 lb	2000 g 4.4 lb	5000 g 11 lb	5000 g ---	10 kg 22 lb	20 kg 44 lb	30 kg 66 lb
Resolution	0.5 g 0.001 lb	1 g 0.002 lb	2 g 0.005 lb	1 g ---	0.005 kg 0.01 lb	0.01 kg 0.02 lb	0.02 kg 0.05 lb
Non-linearity	±1g	±2g	±4g	±4g	±0.01 kg	±0.02 kg	±0.04 kg
Repeatability	0.5g	1g	2g	2g	0.005 kg	0.01 kg	0.02 kg
Span drift	±0.015% / °C TYP (5°C~35°C / 41°F~95°F)						
Operating temperature	-10°C~40°C / 14°F~104°F, Less than 85%RH						
Display	25 mm / 0.98 inches, 7 segment liquid crystal display						
Display update	Approximately 10 times per second						
Power	6 x R20P / LR20 / "D" size batteries or AC adapter						
Battery life	Approximately 600 hours with manganese type 1200 hours with alkaline cells at 20°C / 68°F						
Platform size	232 (W) x 192 (D) mm / 9.13 (W) x 7.56 (D) in.						
Dimensions	266 (W) x 280 (D) x 146 (H) mm / 10.48 (W) x 11.03 (D) x 5.75 (H) in.						
Weight (approx.)	2.9 kg / 6.4 lb				3.2 kg / 7.1 lb		
Calibration weight	1000g±0.1g	2000g±0.2g	5000g±0.5g	5000g±0.5g	10kg ±1g	20kg ±2g	30kg ±2g
Accessories	This manual						
Options	AC adapter						




## The Value of Gravity at Various Locations

Amsterdam	9.813 m/s <sup>2</sup>	Manila	9.784 m/s <sup>2</sup>
Athens	9.807 m/s <sup>2</sup>	Melbourne	9.800 m/s <sup>2</sup>
Auckland NZ	9.799 m/s <sup>2</sup>	Mexico City	9.779 m/s <sup>2</sup>
Bangkok	9.783 m/s <sup>2</sup>	Milan	9.806 m/s <sup>2</sup>
Birmingham	9.813 m/s <sup>2</sup>	New York	9.802 m/s <sup>2</sup>
Brussels	9.811 m/s <sup>2</sup>	Oslo	9.819 m/s <sup>2</sup>
Buenos Aires	9.797 m/s <sup>2</sup>	Ottawa	9.806 m/s <sup>2</sup>
Calcutta	9.788 m/s <sup>2</sup>	Paris	9.809 m/s <sup>2</sup>
Cape Town	9.796 m/s <sup>2</sup>	Rio de Janeiro	9.788 m/s <sup>2</sup>
Chicago	9.803 m/s <sup>2</sup>	Rome	9.803 m/s <sup>2</sup>
Copenhagen	9.815 m/s <sup>2</sup>	San Francisco	9.800 m/s <sup>2</sup>
Cyprus	9.797 m/s <sup>2</sup>	Singapore	9.781 m/s <sup>2</sup>
Djakarta	9.781 m/s <sup>2</sup>	Stockholm	9.818 m/s <sup>2</sup>
Frankfurt	9.810 m/s <sup>2</sup>	Sydney	9.797 m/s <sup>2</sup>
Glasgow	9.816 m/s <sup>2</sup>	Taichung	9.789 m/s <sup>2</sup>
Havana	9.788 m/s <sup>2</sup>	Tainan	9.788 m/s <sup>2</sup>
Helsinki	9.819 m/s <sup>2</sup>	Taipei	9.790 m/s <sup>2</sup>
Kuwait	9.793 m/s <sup>2</sup>	Tokyo	9.798 m/s <sup>2</sup>
Lisbon	9.801 m/s <sup>2</sup>	Vancouver, BC	9.809 m/s <sup>2</sup>
London (Greenwich)	9.812 m/s <sup>2</sup>	Washington DC	9.801 m/s <sup>2</sup>
Los Angeles	9.796 m/s <sup>2</sup>	Wellington NZ	9.803 m/s <sup>2</sup>
Madrid	9.800 m/s <sup>2</sup>	Zurich	9.807 m/s <sup>2</sup>

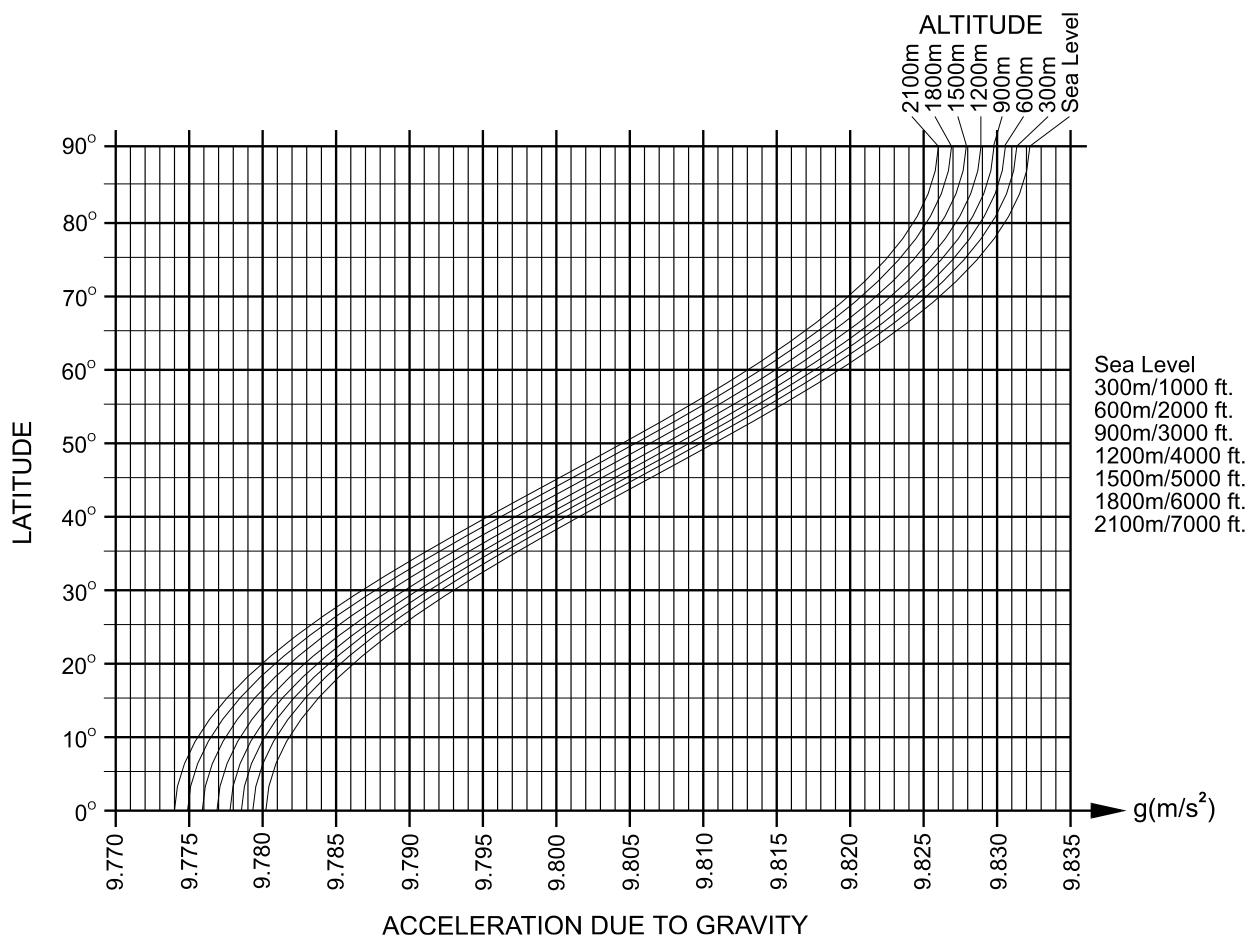

## World Map

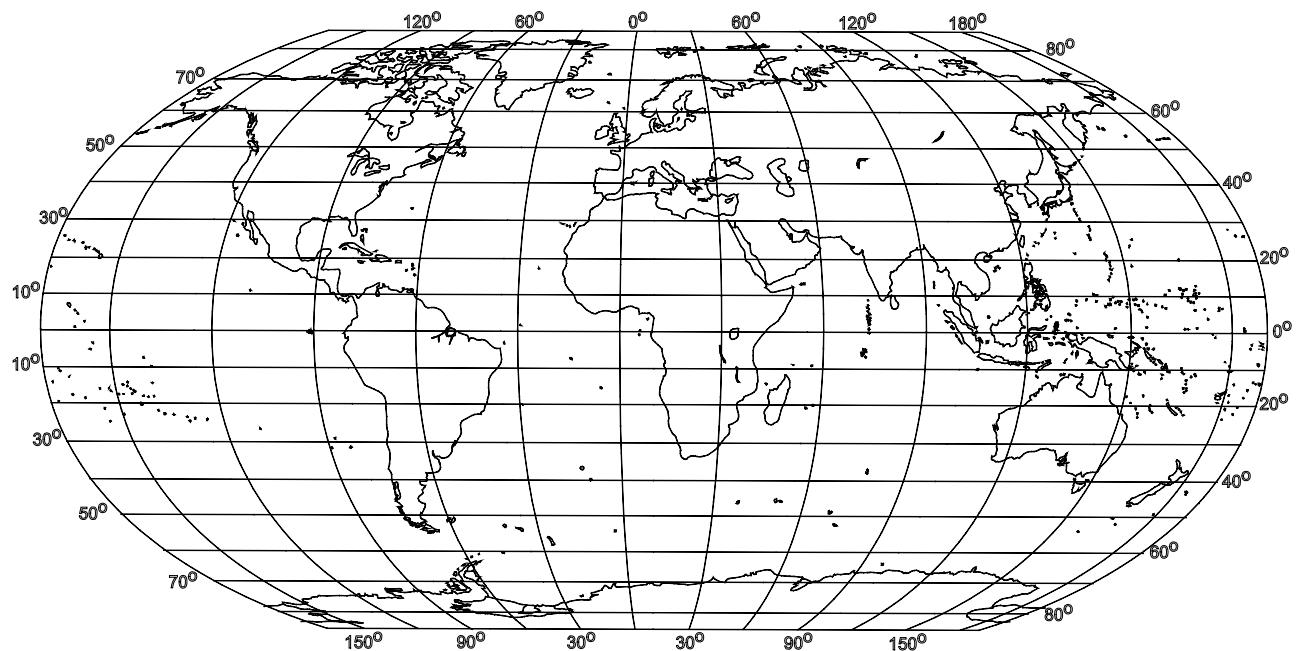



### **A&D Company, Limited**

3-23-14 Higashi-Ikebukuro, Toshima-ku, Tokyo 170-0013, JAPAN

Telephone: [81] (3) 5391-6132 Fax: [81] (3) 5391-1566

### **A&D ENGINEERING, INC.**

47747 Warm Springs Blvd, Fremont, California 94539, U.S.A.

Tel: [1] (800) 726-3364 Weighing Support:[1] (888) 726-5931 Inspection Support:[1] (855) 332-8815

### **A&D INSTRUMENTS LIMITED**

Unit 24/26 Blacklands Way, Abingdon Business Park, Abingdon, Oxfordshire OX14 1DY United Kingdom

Telephone: [44] (1235) 550420 Fax: [44] (1235) 550485

### **A&D AUSTRALASIA PTY LTD**

32 Dew Street, Thebarton, South Australia 5031, AUSTRALIA

Telephone: [61] (8) 8301-8100 Fax: [61] (8) 8352-7409

### **A&D KOREA Limited**

한국에이.엔.디(주)

서울특별시 영등포구 국제금융로6길33 (여의도동) 맨하탄빌딩 817 우편 번호 07331

( 817, Manhattan Bldg., 33. Gukjegeumyung-ro 6-gil, Yeongdeungpo-gu, Seoul, 07331 Korea )

전화: [82] (2) 780-4101 팩스: [82] (2) 782-4264

### **ООО A&D RUS**

ООО "ЭЙ энд ДИ РУС"

Почтовый адрес: 121357, Российская Федерация, г.Москва, ул. Верейская, дом 17

Юридический адрес: 117545, Российская Федерация, г. Москва, ул. Дорожная, д.3, корп.6, комн. 86

( 121357, Russian Federation, Moscow, Vereyskaya Street 17 )

тел.: [7] (495) 937-33-44 факс: [7] (495) 937-55-66

### **A&D Instruments India Private Limited**

ऐंडी इन्स्ट्रमेंट्स इंडिया प्रा० लिमिटेड

D-48, उद्योग विहार , फेस -5, गुर्गांव – 122016, हरियाणा , भारत

( D-48, Udyog Vihar, Phase-V, Gurgaon – 122016, Haryana, India )

फोन : [91] (124) 4715555 फैक्स : [91] (124) 4715599

### **A&D SCIENTECH TAIWAN LIMITED.**

**A&D台灣分公司 艾安得股份有限公司**

台湾台北市中正區青島東路5號4樓

( 4F No.5 Ching Tao East Road, Taipei Taiwan R.O.C. )

Tel : [886](02) 2322-4722

Fax : [886](02) 2392-1794

### **A&D INSTRUMENTS (THAILAND) LIMITED**

บริษัท เอ แอนด์ ดี อินส్టర్మెన్ట్ (ไทยแลนด์) จำกัด

168/16 หมู่ที่ 1 ตำบลรังสิต อำเภอธัญบุรี จังหวัดปทุมธานี 12110 ประเทศไทย

( 168/16 Moo 1, Rangsit, Thanyaburi, Pathumthani 12110 Thailand )

Tel : [66] 20038911