Moisture Analyzer

INSTRUCTION MANUAL

MS-70

MX-50

MF-50

ML-50



This manual and Marks

All safety messages are identified by the following, "WARNING" or "CAUTION", of ANSI Z535.4 (American National Standard Institute: Product Safety Signs and Labels). The meanings are as follows:

⚠ WARNING	A potentially hazardous situation which, if not avoided, could result in death or serious injury.
<u> </u>	A potentially hazardous situation which, if not avoided, may result in minor or moderate injury.



This is a hazard alert mark.



This mark is the IEC417 mark for "Caution. Hot surface". Do not touch parts affixed with this mark without adequate protection.



This mark informs you about the operation of the product.

- □ This manual is subject to change without notice at any time to improve the product.
- Product specifications are subject to change without any obligation on the part of the manufacturer.
- Under the copyright laws, the instruction manual and the software (program) described in it are copyrighted, with all rights reserved.
 The software may be installed into one computer and may not be installed into other computers without the prior written consent of A&D Company. Copying includes translation into another language, reproduction, conversion, photocopy and offer or loan to another person.
- The purchaser may make one copy of the software for backup purposes.
 The manual and the software may not be copied, in whole or part, except as described above.
- Windows is a registered trademark of the Microsoft Corporation.



Contents

1.	S	afety and Compliance	5
2.	Р	recautions	7
	2.1.	Installing the Analyzer	7
	2.2.	During Use	
	2.3.	After Use and Maintaining the Analyzer	
3.	C	Outline and Features	10
4.	P	acking List and Names of Each Part	12
	4.1.	Display and Keys	14
5.	Р	reparations	16
	5.1.	Installing the Analyzer	16
	5.2.	Setting the Clock and Calendar	17
	5.2.1.	Operation	
	5.3.	Proper Operation for Precision Measurement	18
	5.3.1.	Operation of the Sample	
	5.3.2.	Operation of the Analyzer	
	5.3.3.	Glass Fiber Sheets	
6.		Measurement Procedure	20
	6.1.	Standard Mode Operation	20
	6.1.1.	ACCURACY	20
	6.1.2.	Operation	20
	6.2.	Quick Mode Operation	23
	6.2.1.	ACCURACY	23
	6.2.2.	Operation	23
	6.3.	Program Number	26
	6.3.1.	Storing a Measurement Program to a Program Number	26
	6.3.2.	Recalling a Measurement Program with a Program Number	26
7.		Measurement Programs	27
	7.1.	List of Measurement Programs	27
	7.1.1.	ACCURACY of the Standard Mode and Quick Mode	28
	7.1.2.	Analyzing Mode of the Automatic Mode	29
	7.1.3.	Analyzing Mode of the Timer Mode	29
	7.1.4.	Drying Program (Heating Pattern and Drying Temperature)	29
	7.1.5.	Measurement Unit	30
	7.2.	Procedures to Store a Measurement Program	31
	7.2.1.	Standard Drying	31
	7.2.2.	Ramp Drying	34
	7.2.3.	Sten Drving	38

8.	Check Function	43
8.1.	Self-Check Function	43
8.1.	1. Operation	43
8.2.	Test Sample (Sodium Tartrate Dihydrate)	44
9.	Connecting to a Printer	
9.1.	Print Samples	46
9.1.		
9.1.	3	
9.1.	3. Explanation for Print Item	49
10.	Connecting to a Computer	
10.1.	RS-232C Serial Interface	52
10.2.	Output Format	53
10.3.	Command	54
11.	Data Memory Function	55
11.1.	Preparation	55
11.2.	Outputting All Data at One Time	56
11.3.	Deleting All Data at One Time	56
12.	Calibration	57
12.1.	Identification Number (ID No.)	57
12.1	1.1. Setting the ID Number	57
12.2.	Calibrating the Weighting Sensor	58
12.2	2.1. Operation	58
12.3.	Calibrating Drying Temperature (for MS-70 and MX-50)	60
12.3	3.1. Operation	60
13.	Function Table	62
13.1.	Operation	63
14.	Maintenance	64
14.1.	Cleaning the Heater Unit	64
14.2.	Replacing the Halogen Lamp	65
14.3.	Factory Settings	66
14.3	3.1. Operation	66
14.4.	Troubleshooting	67
14.5.	Error Message	68
15.	Specifications	69
15.1.	Dimensions	70
15.2.	Accessories and Options	71



1. Safety and Compliance

AWARNING

- Do not use a sample that could create a hazardous chemical reaction and cause an explosion or poisonous gas, when the sample is dried.
- Keep flammables away from the analyzer.
 Parts of the analyzer become very hot. Materials placed near it might catch fire.
- Do not use the analyzer in ambient ignitable gas. It may cause explosion and fire.
- Use a power source (voltage, frequency, outlet type) adapted to the specification of the analyzer. If excessive voltage is used, the analyzer may overheat and be damage or cause a fire.
- Turn off the power switch and remove the power cord from the power outlet, when replacing the halogen lamp. Touching an electrode of the halogen lamp connector carelessly, it may cause to receive an electric shock.
- □ Do not disassemble the analyzer. It may cause an error, damage, receiving an electric shock or fire. If the analyzer needs service or repair, contact the local A&D dealer.
- Avoid getting the analyzer wet. It is not a water-resistant structure. If there is leakage of liquid into the analyzer, it may cause damage to the analyzer or receiving electric shock.
- Do not look at the active halogen lamp to protect your eyes from damage.
- □ Do not drop, hit or crack the glassware including the halogen lamp, to avoid an injury.
- □ When the halogen lamp is used beyond 5000 hours, we recommend replacing the lamp with a new one to avoid trouble.
- When discarding a halogen lamp, do not break it to avoid scattering glass and injury.

△ CAUTION

- Do not touch the heater cover, the halogen lamp, glass-housing, pan handle, sample pan and sample without adequate protection, it could cause a burn or scald. Parts of the analyzer are very hot when a measurement finishes. For operation, use the specified grips of the heater cover and pan handle. Use the standard accessory tools.
- □ Do not touch parts affixed with the △ mark, because they may get very hot and dangerous.
- □ When the analyzer is used in a room where hot air does not diffuse, it may unexpectedly overheat. In this case, adjust the drying temperature or move the analyzer to a place with adequate ventilation.
- Avoid leaving the analyzer in direct sunlight, as that could cause discoloration of the case or a malfunction.

RISK GROUP 1 NOTICE UV and IR emitted from this product. Do not stare at operating lamp.

Compliance with FCC Rules

Please note that this equipment generates, uses and can radiate radio frequency energy. This equipment has been tested and has been found to comply with the limits of Class A digital devices pursuant to Part 15 of FCC rules. These rules are designed to provide reasonable protection against interference when equipment is operated in a commercial environment. If this unit is operated in a residential area, it may cause some interference and under these circumstances the user would be required to take, at his own expense, whatever measures are necessary to eliminate the interference. (FCC = Federal Communications Commission in the U.S.A.)



2. Precautions



2.1. Installing the Analyzer

--- Caution for Measurement Safety ---

- Do not install the analyzer in a hazardous place.
- Maintain the following ambient condition to operate the analyzer.
 5°C to 40°C (41°F to 104°F), 85%RH or less (no condensation)
- Keep flammables away from the analyzer.
- Do not put anything on the heater cover.
- Do not install the analyzer in a small airtight room. If the analyzer is used in an airtight room, hot air does not diffuse, and the sample may unexpectedly overheat. In this case, the safety circuit of the halogen lamp activates. Move the analyzer to a place with adequate ventilation or adjust the drying temperature.
- There is the voltage label on the back panel of the analyzer.
 Confirm that voltage, frequency and outlet type is correct for your local voltage.
- □ Confirm that the rated voltage of the halogen lamp is correct for your power supply voltage. (Refer to "14.4. Troubleshooting".)

Voltage Label	Power Supply Voltage	The Rated Voltage of Halogen Lamp
100 - 120 V	AC 100 V to AC 120 V	AC 120 V
200 - 240 V	AC 200V to AC 240 V	AC 240 V

- Ground the analyzer using the ground terminal of the power cord.
- □ Do not change the setting of the I/II switch on the rear of the analyzer. If the incorrect setting is used, it may damage the analyzer or cause a fire.

---Caution for Precision Measurement---

Confirm the following condition, because the weighing sensor (S.H.S.) is very sensitive.

- □ The weighing surface should be solid and free from vibration, drafts and as level as possible.
- Install the analyzer in a stable place avoiding vibration and shock.
- Install the analyzer where it is not affected by heaters or air conditioners.
- Ensure a stable power source.
- Keep the analyzer away from equipment that generates magnetic fields.
- Discharge static electricity.




2.2. During Use

---Caution for Measurement Safety ---


Operate the analyzer using the following procedure.

- Put the sample pan in the correct position.
- Handle the grip of the heater cover to open and close it.
- Use the pan handle to move the sample pan.
- Do not touch hot parts around the grass-housing, when the cover is opened.
- □ The glass-housing is very hot. It may cause a burn, if touched.
- The sample pan and pan handle are very hot, when finishing measurement. Allow them to cool down.
- Use the tweezers or spoon to move the sample.

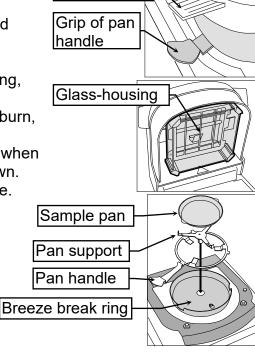


Grip of heater

cover



Grips and Hot Parts

Hot parts are as follows: Use the following grips to operate the analyzer.

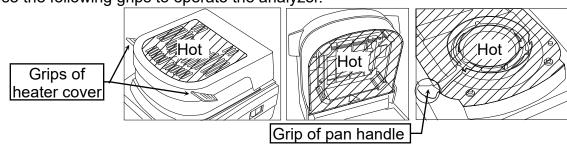

Do Not Measure a Hazardous Sample.

- Do not use an explosive, flammable or noxious substance as a sample. Do not use a sample that creates a hazardous substance by drying it. Do not use unknown substances.
- When a sample surface becomes dry first and the inner pressure increases, the sample may explode. Do not use such a sample.
- Turn off the power switch if a sample catches fire.
- □ The case of the analyzer is made of a flame-retardant substance (UL94 V-0).

Do Not Put any Flammable Matter Around the Analyzer.

- During and after measurement, parts of the analyzer become very hot. Do not put flammable matter near the analyzer.
- Do not put anything on the heater cover.

Caution for Heating (Drying)

- □ When the drying temperature is set to 200°C and measurement is started, the thermostat of the halogen lamp may work after 30 minutes. When the halogen lamp has cooled down, the next measurement can be started. If necessary, change the drying time and temperature.
- When a measurement is started and one hour has passed, the maximum temperature is automatically regulated to 160°C for safety.


Operation to Stop Measurement


□ During measurement, the STOP key is always effective. If there is an error or danger, press the STOP key.


\mathbf{X}

2.3. After Use and Maintaining the Analyzer

- Put the dust cover on the analyzer after it is cool.
- Clean the glass-housing carefully.
- Clean fingerprints from the halogen lamp.
 Refer to "14.2. Replacing the Halogen Lamp".
- Avoid mechanical shock to the analyzer.
- Protect the analyzer from excessive dust.
- Use the packing box (special container) to move the analyzer.
- Clean the analyzer with a lint free cloth that is moistened with warm water and a mild detergent.
- Do not use organic solvents to clean the analyzer.
- Do not disassemble or remodel the analyzer.

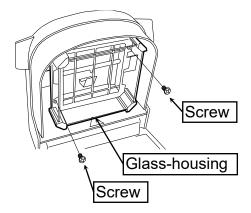

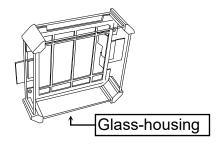

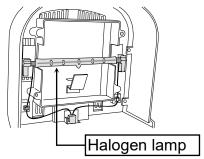



3. Outline and Features

- □ The moisture analyzer was designed using a **s**uper **h**ybrid **s**ensor (S.H.S.) adopted in an analytical balance. Therefore, the results are more precise and get greater repeatability.
- □ The analyzer using the S.H.S. has high sensitivity, needs only a sample quantity of a few grams, and the analysis time becomes shorter.
- A 400W halogen lamp is used as the heating source and the temperature on the sample pan can reach 200°C within two minutes.
- There are five analysis modes.

Standard mode The moisture content can be obtained with settings of the drying temperature and accuracy.

Quick modeSample is heated up for approximately three minutes at 200°C so that analysis time becomes shorter. The moisture content can be obtained with settings of the drying temperature and accuracy

Automatic mode.....When the change of moisture content per minute is less than the preset termination value, the measurement is automatically stopped and the result is obtained.

Timer modeThe sample is dried for a preset time and the result is obtained. **Manual mode**This mode can stop the measurement by key operation and the result is decided.

□ The heating patterns can be used for analysis modes other than the quick mode. (For ML-50, standard drying and quick drying can be used only)

Standard drying......Maintains a constant drying temperature.

Step drying......Uses multiple steps of the drying temperature.

Quick dryingHeats up to 200°C for few minutes and uses a constant drying temperature.

□ The analyzer can store and recall proper individual settings for each sample using a program number (PROG No.).

Maximum program number	MS-70 / MX-50	MF-50	ML-50
	20 sets	10 sets	5 sets

□ The data memory function can store the results and output all of them at one time.

Maximum number of storable results	MS-70 / MX-50	MF-50	ML-50
	100	50	30

- □ The software "WinCT-Moisture", a standard accessory for the MS-70 and MX-50, has a function that can make a graph of the change of moisture content in real time and has an optimum temperature search program that judges heating at an appropriate temperature setting.
- □ The communication software "WinCT", for transmitting data to a computer using Microsoft Windows, can be downloaded from the A&D website.

- □ The analyzer is equipped with a serial interface as standard. It can be connected to a printer or computer.
- The analyzer can calibrate the weighing sensor (Use special mass.) and drying temperature (Use temperature calibrator for MS-70 and MX-50 except MF-50 and ML-50). The analyzer can output the data required at GLP, GMP and ISO at the end of the calibration.
- The analyzer has a self check function that can detect function errors.
- □ The analyzer displays the current change of moisture content per minute [%/ min] in real time. It can be used for the reference to find the analyzing mode.
- The sample pans can be used repeatedly. The sample pans and the disposable aluminum foil pans are included in the standard accessories.
- □ There is a test sample that is used to check the moisture accuracy. (The test sample is a part of the standard accessories except for the ML-50)
- The glass fiber sheets can be used for quick and precise measurement of a liquid sample. (The glass fiber sheets are a part of the standard accessories except for the ML-50)
- A reference card is built into the bottom of the analyzer.


Principle and Use

The moisture analyzer, based on the principle of thermogravimetric analysis, dries a sample using a halogen lamp and obtains the moisture content in % and other results by the difference between the wet weight and dry weight.



4. Packing List and Names of Each Part


- Keep the packing box to move the analyzer.
- Packing list as follows:

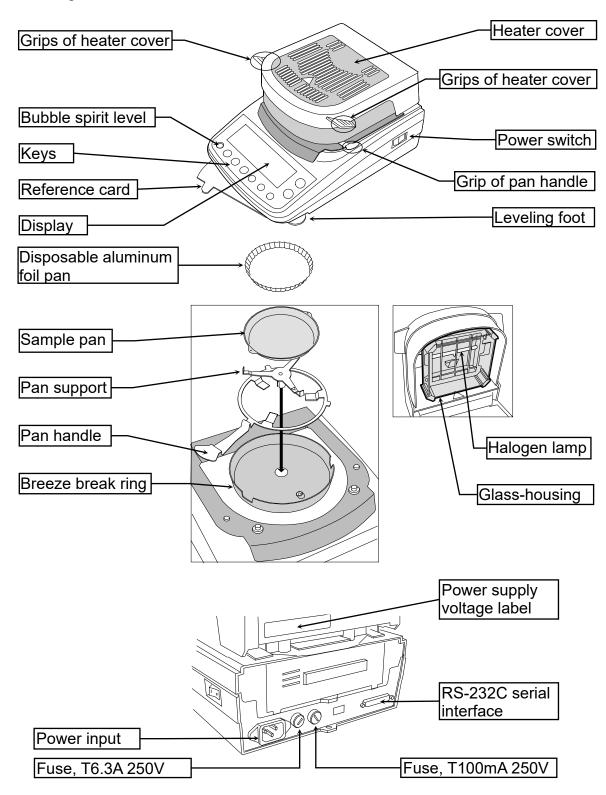

⚠ Caution

Please confirm that the analyzer is correct for your local voltage, receptacle type and the power cord.

Accessory Name

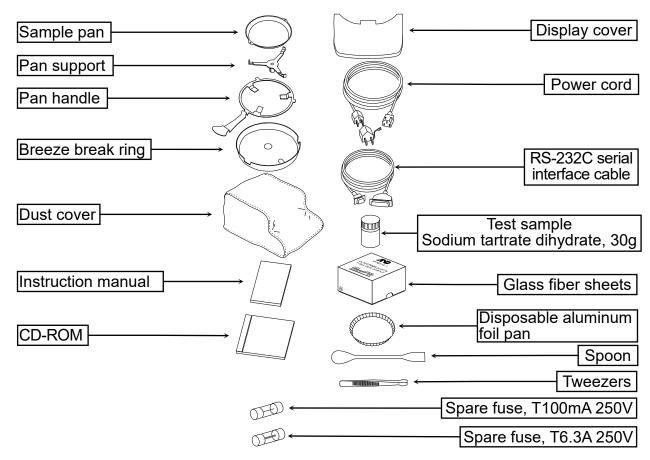


Accessory List

O: Standard accessory, —: Accessory by your order.

	MS-70	MX-50	MF-50	ML-50
Pan support	0	0	0	0
Breeze break ring	0	0	0	0
Display cover	0	0	0	0
Power cord	0	0	0	0
Spare fuse T100mA 250V	0	0	0	0
Spare fuse T6.3A 250V	0	0	0	0
Instruction manual	0	0	0	0
Dust cover	0	0	0	_
Test sample	0	0	0	_
Glass fiber sheets	0	0	0	_
Spoon	0	0	0	_
Tweezers	0	0	0	_
RS-232C serial interface cable	0	0	_	_
Sample pan	20	20	20	10
Pan handle	2	2	2	1
Disposable aluminum foil pan	100	100	100	100
CD-ROM *1	WinCT-Moisture	WinCT-Moisture		_

^{*1:} Application software for Windows.

4.1. Display and Keys

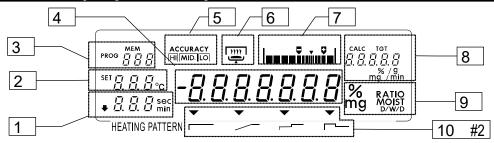

	Name	State and Meaning		
1	Time	At gram display Preset time is displayed at timer mode		
	Time	At measurement Analysis time		
2	Temperature of	At gram display Set temperature of sample pan		
	sample pan	At measurement Current temperature of sample pan		
	PROG: Program No.			
3	MEM: Data No.			
	Analysis mode	At setting Symbols: 5Łd, 9uc, U-R, U-E, U-ñ		
4	Value	At gram display Sample quantity [g]		
		At measurement Current moisture content [%]		
5	Accuracy	Accuracy indicator of measurement		
	Operation indicator	Indicator of heater cover, sample and drying process		
		Sample needs at least 0.1 g or more to start measurement.		
6	1111	Lights when heater cover is closed		
		Blinks during measurement. Disappears when not measuring		
		Sample mark: Lights when the sample is 0.1 g or more.		
		Proper sample Reference of sample quantity		
7	Lovelindicator	quantity range for standard mode and quick		
'	Level indicator	ı ♥ ▼ ♥ ı mode.		
		At grow Standard mode		
8	Target quantity	At gram Quick mode Target quantity of sample [g]		
0		Automatic mode Preset termination value [%/min.]		
	Drying rate	At measurement Current drying rate [%/min.]		
	Measurement unit			
	% MOIST	Moisture content W - D x100 w		
	/W			
	% MOIST	Moisture content (Atro) W - D x100 W: Wet sample mass		
	/D	is based on b		
9	% MOIST	Dry content $\frac{D}{W}$ x100 D: Dried sample mass		
	% MOIST	VV		
		Ratio W x100		
	VV/D	D		
	g	Gram value		
	Heating pattern #1	Maintaina a constant		
	Standard drying	Maintains a constant Drying temperature		
	Ramp drying	drying temperature. Increases the drying		
10		temperature gently. †Drying temperature		
	Step drying	Uses multiple steps of		
		the drying temperature. Drying temperature		
	Quick drying	100000		
		Quick mode \frac{1}{200^{\chick}C} \frac{1}{approx. 3min.} \frac{1}{Drying temperature}		

- ML-50 can select "standard drying" and "quick drying" only. ML-50 does not display "heating pattern". #1
- #2

Display Samples for Analysis Mode

Analysis mode	Symbols (during settings)	Gram display (after settings and before measurement)		
Standard mode	SEd	Target quantity		
Quick mode	9uc	Target quantity		
Automatic mode	U-R	Preset termination value of analyzing mode		
Timer mode	U-E	St 105 % S.O.O. g Preset time		
Manual mode	U-ñ	st 105 % 5.000 g		

Key Operation and Key Functions

	to, operation and ite, another				
k	Keys	Function and action			
PROGRAM	PROGRAM	Stores or recalls measurement program with the program number during the gram display.			
	TROOKAW	Selects a heating pattern while the drying temperature is selected.			
SELECT	SELECT	Selects an item in the measurement program.			
•,•	↓ , ↑	Changes the value of item in the measurement program.			
ENTER		Stores the current condition in the measurement program number. Output data at measurement.			
START	START	Start prepared measurement Sample needs at least 0.1 g or more to start measurement.			
STOP	STOP	Stop the current measurement			
RESET	RESET	Sets the display to zero in the unit of gram. Cancel key.			



5. Preparations



5.1. Installing the Analyzer

- 1. Select the place to install the analyzer. Refer to "2.1. Installing the Analyzer".
- 2. Level the analyzer by adjusting the leveling feet and confirm it using the bubble spirit level.
- 3. Read the power supply voltage label on the back of the heater cover.

Confirm that voltage, frequency and outlet type is correct for your local voltage.

Confirm that the rated voltage of the halogen lamp is correct to your power supply voltage.


Voltage Label	Power Supply Voltage	The Rated Voltage of the Halogen Lamp
100 - 120 V	AC 100 V to AC 120 V	AC 120 V
200 - 240 V	AC 200V to AC 240 V	AC 240 V

- 4. Confirm that the power switch is set to the "OFF" position.
- 5. Connect the power cord. Ground the analyzer with the earth terminal on the power cord.
- 6. Align the guide hole of the breeze break ring to the guide on the body.
- Install the pan support.
 Align together the Δ signs on the pan support and body.
- 8. Put the sample pan on the pan handle.

And hook the pan handle on the notch in the rim of the breeze break ring.

Caution

When a disposable aluminum foil pan is used, be sure to place it on the sample pan.

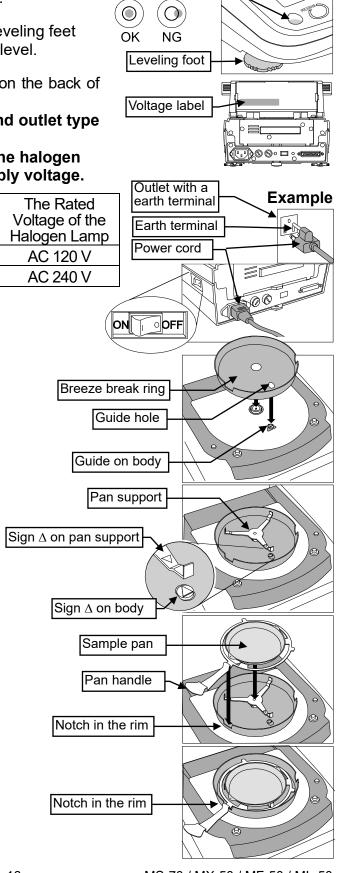

Bubble spirit level

\mathbf{X}

5.2. Setting the Clock and Calendar

Adjust the built-in clock and calendar before use.

5.2.1. Operation

- Turn on the analyzer.
 The gram unit (of weighing mode) is displayed.
- 2. Press and hold the SELECT key to display [[L Rd]].
- 3. Press the ENTER key to display the calendar. Example: 15th April, 2002
- 4. To skip the calendar settings.

To adjust the calendar settings.

Press the SELECT key. Adjust the calendar using the following keys.

SELECT key.....Selects a figure.

<u>↓, ∱ key</u>.....Selects a value for the figure.

ENTER keyStores the current date and proceeds to step 5.

RESET keyCancels the adjustment and proceeds to step 5.

Symbols and arrangement of the calendar

ี่ ^yกิ่dYear, month, day

ก็ฝรีMonth, day, year

ี่⊿ก็∃Day, month, year

The arrangement of the calendar is used for the report of GLP, GMP and ISO.

- 5. Time is displayed.
- 6. To finish the adjustment.

Press the RESET key to proceed to step 7.

To adjust the clock.

Press the SELECT key. Adjust the clock using the following keys.

SELECT key.....Selects a figure.


<u>Ų, ∱ key</u>....Selects a value for the figure.


ENTER keyStores time and proceeds to

step 7.

RESET keyCancels the adjustment and proceeds to step 7.

7. When finishing the adjustment, dP is displayed. Press the RESET key to return to the weighing mode.

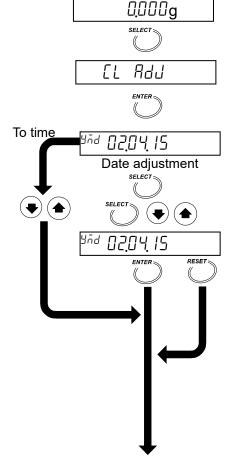

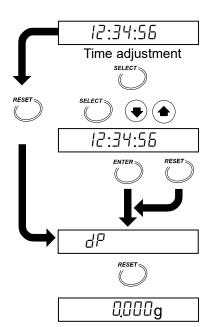



5.3. Proper Operation for Precision Measurement

5.3.1. Operation of the Sample


- Use a proper sample quantity. If the quantity is small, precise results may not be possible.
- If the moisture content of the sample (example: plastic) can be estimated to be less than 1%, the mass of moisture is not enough for the measurement and the result may not be accurate. Consider the following sample mass for the measurement.

An estimate of moisture content	1%	0.5%	0.1%
Necessary mass for measurement	2 g at least	5 g at least	20 g at least


- If the measurement is repeated, maintain the same sample quantity.
- Crush grain samples to a small, uniform powder for a quick drying process.
- Spread the sample as evenly as possible.
- The analyzer is designed to measure the moisture content of the sample by its weight change. If the sample contains volatile matter, it may vaporize during drying causing a measurement error.
- □ When measuring a liquid or liquid state sample that may make a film on the surface, we recommend you use a glass fiber sheet (AX-MX-32-2). Refer to "5.3.3. Glass Fiber Sheets".

5.3.2. Operation of the Analyzer

- Press the RESET key to display the zero value before each measurement.
- Check that the displayed sample weight is stable before measurement. Press the START key to start a measurement.
- Select the proper analysis mode to finish a measurement.
 Use the change of moisture content per minute [%/min] that is displayed during measurement as a reference value.

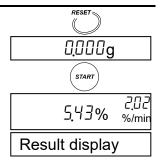


- □ The analyzer needs a pre-heating process before measurement. When measuring samples repeatedly or continuously, the first result is always different from the others.
- □ The pre-heating process is as follows: Put a sample pan, instead of a sample, on the pan. Press the START key to heat it. The analyzer temperature becomes equilibrium.
- Use a sample on the sample pan that has cooled to room temperature. When a sample is put on a hot sample pan, the moisture content is diffused before measurement, and precise results are not possible. We recommend you use multiple sample pans.
- Do not pile up sample pans during a measurement.
- Avoid drift and vibration of air conditioners. It may cause "measurement error" and "unstable value". In particular, because MS-70 is sensitive instrument, it is necessary to consider these influences.
- □ When the difference between ambient temperature and sample temperature is small, it may cause temperature control error.
 - Example: If the drying temperature is set to the range of 30°C and 50°C, it is affected by room temperature.
- Check the activation of the halogen lamp with the operation indicator.
 Example: If low drying temperature is set, the brightness of halogen lamp becomes dark.



5.3.3. Glass Fiber Sheets

Use the glass fiber sheet to measure the moisture content of samples as described in the following examples. When this sheet is used, vaporization of moisture is speeded up and moisture measurement result becomes quick and precise.



- □ This accessory is inclued in the packing for MS-70, MX-50 and MF-50.
- Purchase this accessory by your order for ML-50.
- □ Use the glass fiber sheet (AX-MX32-1) for high surface tension liquid samples.


Example 1: "Liquid Sample" Or "Meltable Sample"

When the glass fiber sheet is used for these measurements, moisture is more apt to vaporize because of expanding the surface area and space. And the glass fiber sheet has the effect of preventing a surface film from forming at drying process.

- A sample containing a lot of moisture
 Milk, yogurt, soybean milk, condensed milk, ketchup, resin, liquid paste, hand soap, etc.
- A sample that melts and adheres to the sample pan.
 Example: Chewing gums, caramel, hony, etc.

Procedure (Preparation before heating)

- 1 Put the glass fiber sheet on the sample pan.
- 2 Press the RESET key to display zero.
- 3 Soak the sample into the glass fiber sheet or put the sample on the glass fiber sheet.
- 4 Press the START key to start the measurement.

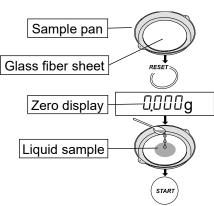

Example 2: "If the Sample's Surface is Apt to Carbonize"

When the sample is covered with a glass fiber sheet, carbonization of the sample surface decreases. Therefore the measurement result becomes repeatable and precise.


A sample including a lot of sugar, protein and oil
 Example: Hony, soybean powder, green tea leaves, cookies, etc.

 A sample that has dark surface and is apt to carbonize Example:Coffee, peanuts, etc.

Procedure (Preparation before heating)

- 1 Put a glass fiber sheet on the sample pan.
- 2 Press the RESET key to display zero.
- 3 Remove the glass fiber sheet.
- 4 Put the sample on the pan.Cover the sample with the glass fiber sheet.

5 Press the START key to start the measurement.

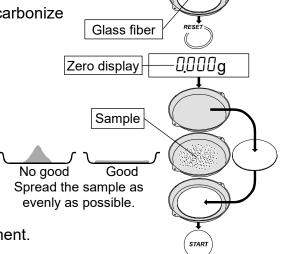

Sample pan



6. Measurement Procedure



6.1. Standard Mode Operation

The standard mode can obtain the moisture content with settings of ACCURACY and drying program (heating pattern, drying temperature).

6.1.1. ACCURACY

ACCURACY of measurement can be set to either HI, MID. or LO.

The sample quantity is automatically selected by ACCURACY.

The termination value of the analyzing mode is automatically selected by ACCURACY and minimum scale value of % display.

The analysis mode is the program to finish the measurement when a change of moisture content per minute becomes smaller than a preset termination value.

The settings are as follows: Specify the ACCURACY.

			ACCURACY		
	Model	Minimum scale	HI	LO	
		0.001 %	0.01 %/min	0.02 %/min	0.05 %/min
	MS-70	0.01 %	0.02 %/min	0.05 %/min	0.10 %/min
		0.1 %	0.10 %/min	0.20 %/min	0.50 %/min
5 ,	MX-50	0.01 %	0.02 %/min	0.05 %/min	0.10 %/min
Preset Termination value		0.1 %	0.10 %/min	0.20 %/min	
	MF-50	0.05 %	0.05 %/min	0.10 %/min	
, card		0.1 %	0.10 %/min	0.20 %/min	0.50 %/min
		1 %			
	ML-50	0.1 %			
		1 %			
Sample quantity		10 g	5 g	1 g	
Use			Precise result		measurement

6.1.2. Operation

This operation explanation uses the following example of the MX-50: Refer to "7. Measurement Programs" for details.

I	ln	nı	ıŧ	P	ara	m	۵t	ers	

Stored Parameters (Factory Settings for the MX-50)

 Turn on the analyzer.
 The gram unit (of weighing mode) is displayed.

Enter the Standard Mode

2. Press the SELECT key to display an analysis mode and press the or key to select 5td.

Standard mode SELECT SELECT

Temperature

Select ACCURACY

- 3. Press the SELECT key to select ACCURACY. When ACCURACY is selected, HI, MID. or LO blinks.
- 4. Press the ☐ or ☐ key to select LO of ACCURACY.

Set Drying Temperature at the Sample Pan


- 5. Press the SELECT key to select the drying temperature.
- 6. Press the ↓ or ↑ key to set 130 °C.

Store the Parameters and Finish the Operation

7. Press the **ENTER** key to store the parameters. The weighing mode is automatically displayed.

Put a Sample on the Pan

- 8. Put the breeze break ring, pan support, pan handle and sample pan in order. (With no sample.)
- 9. Close the heater cover.
- 10. When the displayed value is stable, press the RESET key to set the display to zero. Avoid mechanical vibration, breeze and environmental noise during measurement.
 If the display is not zero, press the RESET key again.

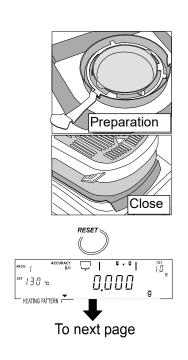

Fod


™ 105 °c

HEATING PATTERN

0.0

0.000

11. Open the heater cover. Place a sample referring to the level indicator.



Sample needs to be more than 0.1 g. The mark lights when the sample is 0.1 g or more.

Caution

The sample needs to be more than 0.1 g. Spread the sample evenly.

12. If the \(\bar{1}\) key is pressed during the gram display, analysis mode, measurement unit and minimum scale value are displayed. If the \(\bar{ENTER} \) key is pressed, the sample mass is output.

Start the Measurement

- 13. Close the heater cover. Press the START key after a stable value is displayed.
- 14. If the SELECT key is pressed during measurement, other units can be displayed temporarily and its measurement values can be output.

Caution

Do not press the **SELECT** key while sampling data.

Finish the Measurement

- 15. When the change of moisture content per minute (drying rate) reaches the preset termination value, the measurement is completed and the buzzer beeps.
- 16. Open the heater cover and remove the sample using the pan handle.
- 17. Press the following key to return to the gram display.


 ENTER | key.....Outputs (Prints) result.

SELECT key.....Returns to the weighing mode.

RESET key.....Returns to the weighing mode and displays zero.

18. If the same condition is used, return to step 8.To change the condition, return to step 2.

The sample pans can be washed and reused. There is the reference card on the bottom of the analyzer.

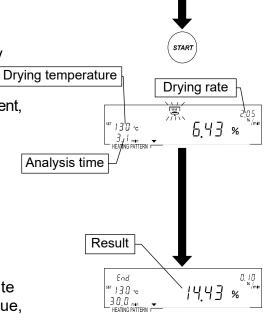

SELEC1

^{set} 130 °c

From last page

Good

Close

No good

™130 °c


Remove sample

or



6.2. Quick Mode Operation

The quick mode can obtain the moisture content with settings of ACCURACY and drying temperature. Sample is heated up at 200°C for approximately three minutes so that moisture content is measured quickly.



6.2.1. ACCURACY

ACCURACY of measurement can be set to either HI, MID. or LO.

The sample quantity is automatically selected by ACCURACY.

The termination value of the analysis mode is automatically selected by ACCURACY and minimum scale value of % display.

Analysis mode is the program to finish the measurement when a change of moisture content per minute becomes smaller than a preset termination value.

The settings are as follows: Specify the ACCURACY.

			ACCURACY			
	Model	Minimum scale	HI	MID.	LO	
		0.001 %	0.02 %/min	0.05 %/min	0.05 %/min	
	MS-70	0.01 %	0.05 %/min	0.10 %/min	0.20 %/min	
		0.1 %	0.10 %/min	0.20 %/min	0.50 %/min	
	MX-50	0.01 %	0.05 %/min 0.10 %/min		0.20 %/min	
Preset Termination		0.1 %	0.10 %/min 0.20 %/min		0.50 %/min	
value	MF-50	0.05 %	0.10 %/min	0.20 %/min	0.50 %/min	
		0.1 %				
		1 %				
	NAL CO	0.1 %	0.20 %/min	0.50 %/min	1.00 %/min	
	ML-50	1 %		0.50 /0/111111	1.00 /6/111111	
S	Sample quantity			2 g	1 g	
Use			Precise result		measurement	

6.2.2. Operation

This operation explanation uses the following example of the MX-50: Refer to "7. Measurement Programs" for details.

Input Parameters

ACCURACYLO

Stored Parameters (Factory Settings for the MX-50)

on a wet sample Minimum scale value of % display...... 0.01 %

Minimum scale value of the gram display.. 0.001 g

Data memory function Not used

1. Turn on the analyzer. The gram unit (of weighing mode) is displayed.

Enter the Quick Mode

2. Press the SELECT key to display an analysis mode and press the \mathbb{Q} or \mathbb{T} key to select \mathbb{Q}_{uc} .

|set | 0 5 °c HEATING PATTERN Quick mode 2.0 0.0 1 HEATING PATTERN Quick drying ML-50 does not display ACCURACY 900 "105 % HEATING PATTERN Temperature

Select ACCURACY

- 3. Press the SELECT key to select ACCURACY. When ACCURACY is selected, HI, MID. or LO blinks.
- 4. Press the □ or ↑ key to select □ of ACCURACY.

Set Drying Temperature at the Sample Pan


- 5. Press the SELECT key to select the drying temperature.
- 6. Press the □ or ↑ key to set 130 °C.

Store Parameters and Finish the Operation

7. Press the ENTER key to store the parameters. The weighing mode is automatically displayed.


Put a Sample on the Pan

- 8. Put the breeze break ring, pan support, pan handle and sample pan in order. (With no sample.)
- 9. Close the heater cover.
- 10. When the displayed value is stable, press the RESET key to set the display to zero. Avoid mechanical vibration, breeze and environmental noise during measurement. If the display is not zero, press the | RESET | key again.

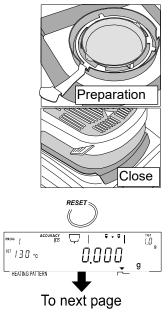

End

|^{SET} 105 ℃ HEATING PATTERN 11. Open the heater cover. Places a sample while referring to the level indicator.



Sample needs to be more than 0.1 g. The mark lights when the sample is 0.1 g or more.

Range of proper sample

Caution

The sample needs to be more than 0.1 g. Spread the sample evenly.

12. If the had key is pressed during the gram display, analysis mode, measurement unit and minimum scale value are displayed. If the ENTER key is pressed, sample mass is output.

Start the Measurement

- 13. Close the heater cover. Press the START key after a stable value is displayed.
- 14. If the SELECT key is pressed during measurement, other units can be displayed temporarily and its measurement values can be output.

Caution

Do not press the **SELECT** key while sampling data.

Finish the Measurement

- 15. When the change of moisture content per minute (drying rate) reaches the preset termination value, the measurement is completed and the buzzer beeps.
- 16. Open the heater cover and remove the sample using the pan handle.
- 17. Press the following key to return to the gram display.


 ENTER key.....Outputs (Prints) result.

SELECT key.....Returns to the weighing mode.

RESET key.....Returns to the weighing mode and displays zero.

18. If the same condition is used, return to step 8. To change the condition, return to step 2.

The sample pans can be washed and reused. There is the reference card on the bottom of the analyzer.

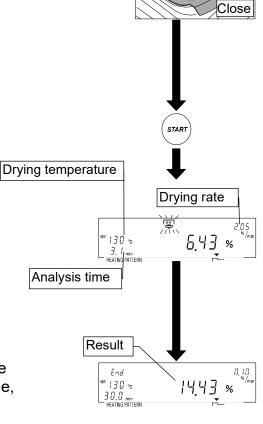


From last page

Good

No good

^{set} 130 °c

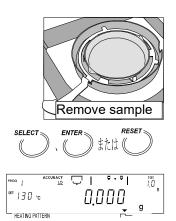

6.3. Program Number

The measurement conditions of all program numbers are set to the standard mode at the factory. The analyzer can store and recall proper individual settings for each sample with the program number (PROG No.).

MS-70 / MX-50 20 sets PROG 1 to 20 MF-50 10 sets PROG 1 to 10 ML-50 5 sets PROG 1 to 5

The same measurement program is stored in all program numbers with factory settings.

Analysis mode......Standard mode Heating patternStandard drying



0.000

Caution If the data memory function is active, the data memory number (MEM) is displayed in place of the program number (PROG).

6.3.1. Storing a Measurement Program to a Program Number

The measurement program of the displayed or recalled PROG number can be renewed.

1. Press and hold the PROGRAM key in the gram display.

2. Press the □ or ↑ key to select a program number

3. Press the ENTER key to use the selected number.

4. Press the SELECT key to edit the parameters.

5. Edit parameters of a measurement program. Refer to "7. Measurement Programs".

6. Press the following key to return to the gram display.

ENTER key.....Stores parameters to the selected number.

RESET key.....Cancels the operation and returns to the weighing mode.

PROG 2 QQQqq

PROG 🗒

0.000a


6.3.2. Recalling a Measurement Program with a Program Number

Stored measurement programs can be recalled with a program number.

1. Press and hold the PROGRAM key in the gram display.

2. Press the □ or ↑ key to select a program number

3. Press the ENTER key to use the selected number.

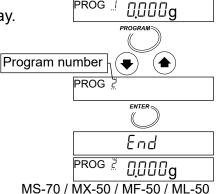



7. Measurement Programs

X

7.1. List of Measurement Programs

There are five analysis modes.

	Measurement Programs					
		Drying Program				
	Analyzing mode to Finish	Heating pa	Drying Temperature			
	Measurement	MS-70, MX-50, MF-50	ML-50	MS-70	MX-50 MF-50 ML-50	
Standard Mode 5Ed	Measurement condition is automatically selected by ACCURACY and minimum value of % display.	Standard drying Ramp drying Step drying	Standard drying			
Quick Mode	When drying rate is less than preset termination value, measurement is completed automatically.	Quick drying		30°C	50°C	
Automatic Mode U-R	When drying rate is less than preset termination value, measurement is completed automatically.	Standard	Standard	to 200°C	to 200°C	
Timer Mode	Sample is dried for a preset time. 1 min. to 480 min.	drying Ramp drying Step drying	drying			
Manual Mode ป-กั	Measurement is completed by the STOP key. Max. 480 min.	Step drying				

Drying rate: Change of moisture content per minute [%/min]

7.1.1. ACCURACY of the Standard Mode and Quick Mode

ACCURACY of measurement can be set to either [HI], MID. or [LO].

The sample quantity is automatically selected by ACCURACY.

The termination value of the analyzing mode is automatically selected by ACCURACY and minimum scale value of % display.

The analyzing mode is the program to finish the measurement when a change of moisture content per minute becomes smaller than a preset termination value.

The settings are as follows: Specify the ACCURACY.

Drying rate: Change of moisture content per minute [%/min]

Standard Mode

			ACCURACY			
	Model	Minimum scale	HI	MID.	LO	
		0.001 %	0.01 %/min	0.02 %/min	0.05 %/min	
	MS-70	0.01 %	0.02 %/min	0.05 %/min	0.10 %/min	
		0.1 %	0.10 %/min	0.20 %/min	0.50 %/min	
	MX-50	0.01 %	0.02 %/min	0.05 %/min	0.10 %/min	
Preset Termination		0.1 %	0.10 %/min	0.20 %/min		
value	MF-50	0.05 %	0.05 %/min	0.10 %/min		
		0.1 %	0.10 %/min	0.20 %/min	0.50 %/min	
		1 %				
	N41 50	0.1 %				
	ML-50	1 %				
Sample quantity			10 g	5 g	1 g	
Use			Precise result		measurement	

Quick Mode

			ACCURACY			
	Model	Minimum scale	HI	LO		
		0.001 %	0.02 %/min	0.05 %/min	0.05 %/min	
	MS-70	0.01 %	0.05 %/min	0.10 %/min	0.20 %/min	
		0.1 %	0.10 %/min	0.20 %/min	0.50 %/min	
	MX-50	0.01 %	0.05 %/min	0.10 %/min	0.20 %/min	
Preset		0.1 %	0.10 %/min	0.20 %/min	0.50 %/min	
Termination value	MF-50	0.05 %	0.10 %/min	0.20 %/min	0.50 %/min	
74.45		0.1 %				
		1 %				
	NAL 50	0.1 %	0.20 %/min	0.50.0//min	4.00.0//	
	ML-50	1 %	0.20 70/111111	0.50 %/min	1.00 %/min	
S	Sample quantity			2 g	1 g	
Use			Precise result		measurement	

7.1.2. Analyzing Mode of the Automatic Mode

When the change of moisture content per minute is less than the preset value, the

measurement is automatically completed.

medicinent is determined by completed.							
Preset Termination	Range						
value to complete measurement	MS-70	MX-50	MF-50	ML-50			
2.00 %/min	↑	↑	†	†			
1.00 %/min							
0.50 %/min			Available	Available			
0.20 %/min		Available	range	range			
0.10 %/min	Available	range	(Factory setting)	(Factory setting)			
0.05 %/min	range	(Factory setting)		\			
0.02 %/min	(Factory setting)		*				
0.01 %/min							
0.005 %/min		V					
0.002 %/min			Inavailable iten	2			
0.001 %/min	\	Unavailable item					

7.1.3. Analyzing Mode of the Timer Mode

Sample is dried for a preset analysis time.

Drying Time 1 minute to 480 minutes.


Setting interval: 1 minute during 1 minute to 60 minutes.

5 minutes during 60 minutes to 480 minutes.

Factory setting: 10 minutes.

7.1.4. Drying Program (Heating Pattern and Drying Temperature)

Heating Pattern

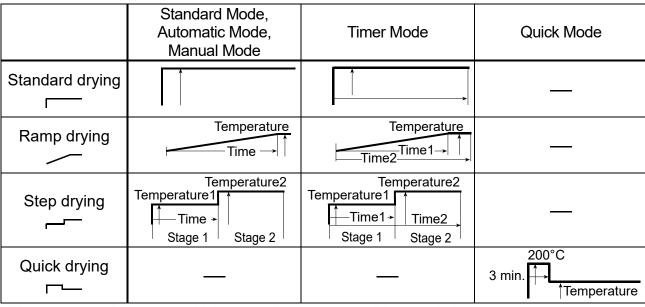

[&]quot;Temperature 1" can be set higher than "temperature 2" in step drying.


For "time 2" in step drying, set the time from the start of measurement.

ML-50, can select standard drying and quick drying only, does not display heating pattern.

How to Select Quick Mode (Extracts)

Press the SELECT key during the gram display. Display $\boxed{q_{u\varepsilon}}$ using the \square or \square key.

ML-50 does not display heating pattern.




How to Select a Heating Pattern for Modes Other Than the Quick Mode (Extracts)


Press the SELECT key to select temperature during the gram display.

Press the PROGRAM key to select a heating pattern.

ML-50 can select standard drying and quick drying only.



Display Examples During Settings

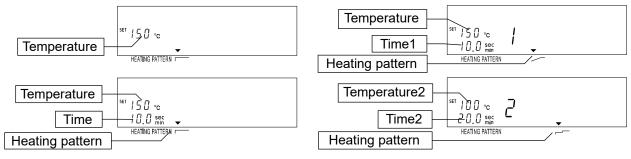

Drying Temperature at the Sample Pan

Drying temperature range for MS-7030°C to 200°C, 1°C interval. Drying temperature range for MX-50, MF-50 and ML-5050°C to 200°C, 1°C interval. When a measurement is started and one hour has passed, the maximum temperature is automatically regulated to 160°C for safety.

7.1.5. Measurement Unit

Unit		Formula	Display
Moisture content is based on		<u>W-D</u> x 100	% MOIST
wet sample mass	*1	W	/W
Moisture content (Atro) is based on		<u>W - D</u> x 100	% MOIST
dried sample mass		D	/D
Dry content		x 100	% RATIO
Dry content		W	D/W
Ratio	*2	W x 100	% RATIO
Natio	↑ Z	D	W/D
Gram value			g

W: Wet sample mass

D: Dried sample mass

*1: Factory settings

*2: When result reaches to 999%, measurement is stopped.



7.2. Procedures to Store a Measurement Program

7.2.1. Standard Drying

This explanation uses the following parameters and sample displays of MX-50.

Drying temperature Drying temperature Time Standard Mode, Automatic Mode, Manual Mode Timer Mode Common Items Heating pattern.....Standard drying () Drying program Drying temperature 160°C % MOIST Minimum scale value during measurement .. 0.01 % Minimum scale value of the gram display.....0.001 g Sample quantity......Approximately 5 g Data memory functionNot used Items for Standard Mode Analysis modeStandard mode (Symbol: | 5td |) ACCURACYMID. Analyzing mode to finish a measurement....... Automatic setting by ACCURACY Items for Automatic Mode Analyzing mode to finish measurement 0.05 %/min

Items for Manual Mode

Items for Timer Mode

Analysis modeManual mode (Symbol: [- - - -])


1. Display the gram unit (of the weighing mode).

Select a Program Number to Edit the Measurement Program

 Press the PROGRAM key and press the ↓ or ↑ key to select a program number.

- 3. Press the ENTER key to use the number.
- 4. The analyzer displays *ξnd* and returns to the weighing mode.

Caution If the data memory function is active, the data memory number (MEM) is displayed in place of the program number (PROG).

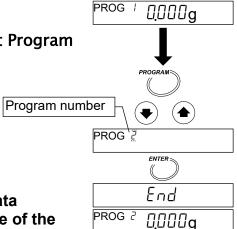

Select an Analysis Mode

5. Press the SELECT key to select a symbol. The selected symbol will blink. Select an analysis mode using the ↓ or ↑ key.

Set ACCURACY for the Standard Mode

6. Select ACCURACY with the SELECT key. Select MID. with the ☐ or ↑ key. When ACCURACY is selected, HI, MID. or LO blinks.

Set the Heating Pattern

7. Select the drying temperature with the SELECT key. Select standard drying of the heating pattern with the PROGRAM key.

Set the Drying Temperature

8. Set 160°C with the □ or ↑ key.

Set the Preset Termination Value for Automatic Mode

Select the preset termination value with the SELECT key.
 Select 0.05 [%/min] with the □ or ↑ key.

Set the Analysis Time for the Timer Mode


10. Select time with the SELECT key. Select 10.0 [min] with the ↓ or ↑ key.

Set the Measurement Unit

11. Select a measurement unit with the SELECT key. Select a moisture content (based on a wet sample) with the □ or ↑ key.

Set the Minimum Scale Value of the % Display

12. Select % display with the SELECT key. Select 0.01 [%] with the ↓ or ↑ key.

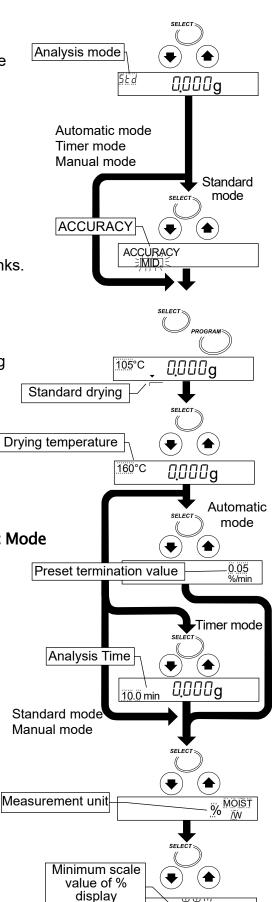


Set the Minimum Scale Value of the Gram Display

13. Select the gram display with the SELECT key. Select 0.001 [g] with the □ or ↑ key.

Store the Parameters and Finish the Operation

14. Press the ENTER key to store the new parameters for the measurement program to program number 2. Pressing the key, the weighing mode is automatically displayed. When PROG 2 is recalled, the settings can be used.

To cancel the new parameters and return to the weighing mode, press the RESET key.

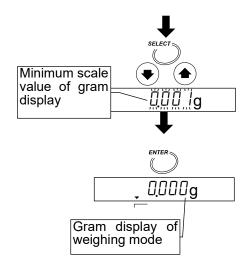


Standard Mode, Automatic Mode or Manual Mode

Refer to page 36 for Timer Mode.

MOIST

This explanation uses the following parameters and sample displays of MX-50.



Common Items

Program number......3 (PROG 3)

Drying program Heating pattern.....Ramp drying ()

Final drying temperature..... 160°C

Ramp time5.0 minutes

Measurement Unit Moisture content

Minimum scale value during measurement ..0.01 %

Minimum scale value of the gram display.....0.001 g

Sample quantity......Approximately 5 g

Data memory functionNot used

Items for Standard Mode

Analysis modeStandard mode (Symbol: 5td)

ACCURACYMID.

Analyzing mode to finish measurement Automatic setting by ACCURACY

Items for Automatic Mode

Analyzing mode to finish measurement 0.05 %/min

Items for Manual Mode

Analysis modeManual mode (Symbol: 🗓 - - - - -)


1. Display gram unit (of the weighing mode).

Select a Program Number to Edit the Measurement Program

2. Press the PROGRAM key and press the ↓ or ↑ key to select a program number.

- 3. Press the ENTER key to use the number.
- 4. The analyzer displays $\boxed{\mathcal{E}_{nd}}$ and returns to the weighing mode.

Caution If the data memory function is active, the data memory number (MEM) is displayed in place of the program number (PROG).

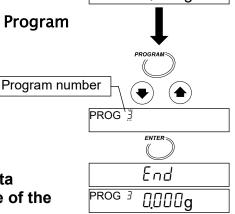

0,000g

PROG /

Select an Analysis Mode

5. Press the SELECT key to select a symbol. The selected symbol will blink. Select an analysis mode using the ☐ or ☐ key. If standard mode is used, select ☐ bbd. If automatic mode is used, select ☐ U-B. If manual mode is used, select ☐ U-B.

Set ACCURACY for Standard Mode

6. Select ACCURACY with the SELECT key. Select MID. with the ☐ or ↑ key. When ACCURACY is selected, HI, MID. or LO blinks.

Set the Heating Pattern

7. Select the drying temperature with the SELECT key. Select ramp drying of heating pattern with the PROGRAM key.

Set the Final Drying Temperature

8. Set 160°C with the ☐ or ☐ key.

Set the Ramp Time

9. Set 5.0 minutes with the □ or 1 key.

Set the Preset Termination Value for Automatic Mode

Select the preset termination value with the SELECT key.
 Select 0.05 [%/min] with the □ or ↑ key.

Set the Measurement Unit


11. Select measurement unit with the SELECT key. Select a moisture content (based on a wet sample) with the □ or ↑ key.

Set the Minimum Scale Value of the % Display

12. Select % display with the SELECT key. Select 0.01 [%] with the ☐ or ☐ key.

Set the Minimum Scale Value of the Gram Display

13. Select the gram display with the SELECT key. Select 0.001 [g] with the □ or ↑ key.

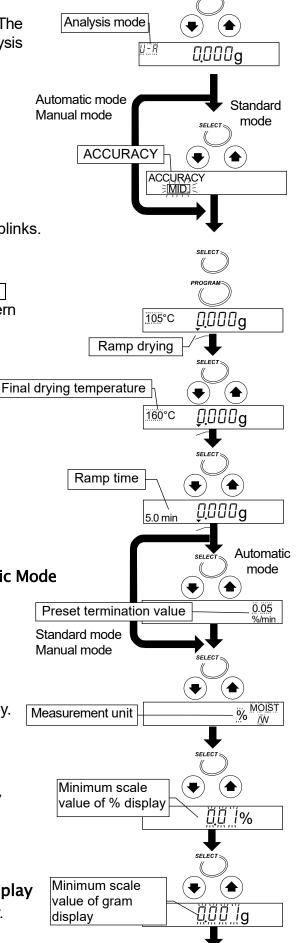


Store Parameters and Finish the Operation

14. Press the ENTER key to store the new parameters of the measurement program to program number 3. Pressing the key, the weighing mode is automatically displayed.

When PROG 3 is recalled, the settings can be used.


To cancel the new parameters and return to the weighing mode, press the RESET key.

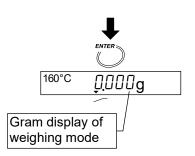

Timer Mode

Refer to page 34 for Standard Mode, Automatic Mode or Manual Mode.

This explanation uses the following parameters and sample displays of MX-50.



Common Items

Program number......4 (PROG 4)

Analysis modeTimer mode (Symbol: 🗓-ك)

Drying program Heating pattern.....Ramp drying ()

Final drying temperature..... 160°C

Minimum scale value during measurement ..0.01 %

Minimum scale value of the gram display.....0.001 g

Sample quantity......Approximately 5 q

Data memory functionNot used


1. Display gram unit (of the weighing mode).

Select a Program Number to Edit the Measurement Program

2. Press the PROGRAM key and press the □ or ↑ key to select a program number.

- 3. Press the ENTER key to use the number.
- 4. The analyzer displays *ξnd* and returns to the weighing mode.

Caution If the data memory function is active, the data memory number (MEM) is displayed in place of the program number (PROG).

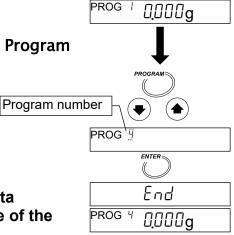

MOIST

Select an Analysis Mode

5. Press the SELECT key to select a symbol.

The selected symbol will blink. Select U--- of the timer mode with the or key. (Press these keys to select it)

Set the Heating Pattern

6. Select the drying temperature with the SELECT key. Select ramp drying of the heating pattern with the PROGRAM key.

Set the Final Drying Temperature

7. Set 160°C with the ↓ or ↑ key.

Set the Ramp Time

8. Set 5.0 minutes with the \square or \bigcap key.

Set the Analysis Time

Set a Measurement Unit

10. Select a measurement unit with the SELECT key. Select moisture content (based on a wet sample) with the ☐ or ☐ key.

Set the Minimum Scale Value of the % Display

11. Select the % display with the SELECT key. Select 0.01 [%] with the ↓ or ↑ key.

Set the Minimum Scale Value of the Gram Display


12. Select the gram display with the SELECT key. Select 0.001 [g] with the □ or ↑ key.

Store the Parameters and Finish the Operation

13. Press the ENTER key to store the new parameters of the measurement program to program number 4. Pressing the key, the weighing mode is automatically displayed. When PROG 4 is recalled, the settings can be used.

To cancel the new parameters and return to the

weighing mode, press the RESET key.

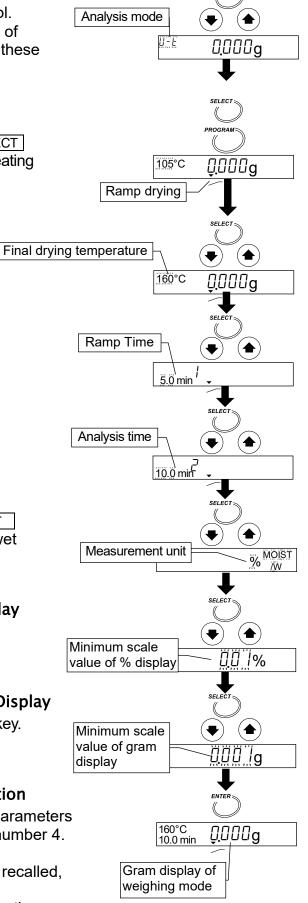

Standard Mode, Automatic Mode or Manual Mode

Refer to page 40 for Timer Mode.

This explanation uses the following parameters and sample displays of MX-50.

	Drying temperature 2	
Drying temperature 1		l
Time ,		l
Stage 1	Stage 2	

Common Items

Drying program Heating pattern.....Step drying (—) Drying temperature 1......120°C

Drying temperature 2 160°C Time5.0 minutes

MOIST

Minimum scale value during measurement .. 0.01 % Minimum scale value of the gram display.....0.001 g

Sample quantity......Approximately 5 g

Data memory functionNot used

Items for Standard Mode

Analysis modeStandard mode (Symbol: | 5년 년 |)

ACCURACYMID.

Analyzing mode to finish measurement......Automatic setting by ACCURACY

Items for Automatic Mode

Analysis modeAutomatic mode (Symbol: | 4-8 |)

Analyzing mode to finish measurement 0.05 %/min

Items for Manual Mode


1. Display gram unit (of the weighing mode).

Select a Program Number to Edit the Measurement Program

2. Press the PROGRAM key and press the □ or ↑ key to select a program number.

- 3. Press the ENTER key to use the number.
- 4. The analyzer displays End and returns to the weighing mode.

If the data memory function is active, the data Caution memory number (MEM) is displayed in place of the program number (PROG).

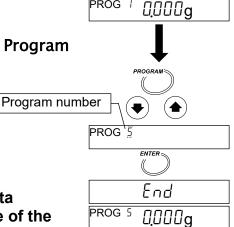

PROG

[&]quot;Temperature 1" can be set higher than "temperature 2" in step drying.

Select an Analysis Mode

5. Press the SELECT key to blink a symbol, The selected symbol will blink. Select an analysis mode using the ☐ or ☐ key.

If standard mode is used, select 5₺d.

If standard mode is used, select [58d]. If automatic mode is used, select [68d]. If manual mode is used, select [68d].

Set ACCURACY for the Standard Mode

6. Select ACCURACY with the SELECT key. Select MID. with the ☐ or ↑ key. When ACCURACY is selected, HI, MID. or LO blinks.

Set the Heating Pattern

7. Select the drying temperature 1 with the SELECT key. Select step drying — of the heating pattern with the PROGRAM key.

Set Drying Temperature 1

8. Set 120°C to drying temperature 1 with the ∏ or ∏ key.

Set the Time

9. Select time with the SELECT key. Set 5.0 minutes with the □ or ↑ key.

Set Drying Temperature 2


 Select the drying temperature 2 with the SELECT key.
 Set 160°C with the □ or ↑ key.

Set the Preset Termination Value for Automatic Mode

11. Select a preset termination value with the SELECT key. Select 0.05 [%/min] with the ↓ or ↑ key.

Set Measurement Unit

12. Select measurement unit with the SELECT key. Select moisture content (based on a wet sample) with the □ or ↑ key.

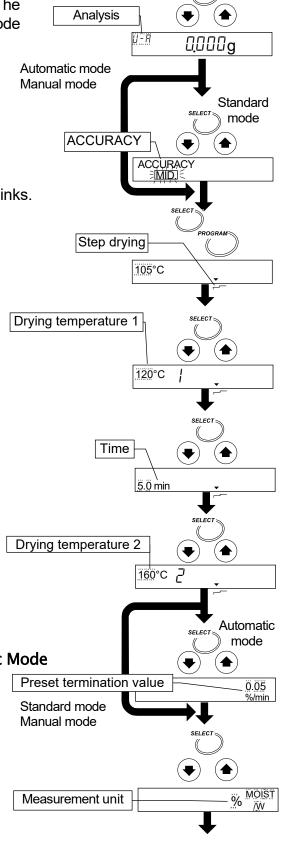

Set the Minimum Scale Value of the % Display

13. Select the % display with the SELECT key. Select 0.01 [%] with the □ or ↑ key.

Set the Minimum Scale Value of the Gram Display

14. Select the gram display with the SELECT key. Select 0.001 [g] with the ☐ or ↑ key.

Minimum scale value of % display Minimum scale value of gram display ers of Gram display of weighing mode

Store the Parameters and Finish the Operation

15. Press the ENTER key to store the new parameters of the measurement program to program number 3. Pressing the key, the weighing mode is automatically displayed.


When PROG 3 is recalled, the settings can be used.

To cancel new parameters and return to weighing mode, press the RESET key.

Timer Mode

Refer to page 38 for Standard Mode, Automatic Mode or Manual Mode.

This explanation uses the following parameters and sample displays of MX-50.



[&]quot;Temperature 1" can be set higher than "temperature 2" in step drying.


Common Items

•	r	,	ad: [!]
•		, ,	
Drying program	Heating pattern	Step drying (—──	⁻)
	Drying temperature 1	160°C	
	Drying temperature 2		
	Time 1	5.0 minutes	
	Time 2	10.0 minutes	0/ MOICT
Measurement uni	it	Moisture content	% MOIST /W
Minimum scale v	alue during measurement	0.01 %	,,,,
Minimum scale v	alue of the gram display	0.001 g	
Sample quantity		Approximately 5 g	
Data memory fur	nction	Not used	

1. Display gram unit (of the weighing mode).

Select a Program Number to Edit the Measurement Program

- 2. Press the PROGRAM key and press the □ or ↑ key to select a program number.
- 3. Press the ENTER key to use the number.
- 4. The analyzer displays *End* and returns to the weighing mode.




Select an Analysis Mode

5. Press the SELECT key to select a symbol. The selected symbol will blink. Select ☐ ☐ of the timer mode with the ☐ or ☐ key. (Press these keys to select it)

Set the Heating Pattern

6. Select the drying temperature with the SELECT key. Select step drying — of the heating pattern with the PROGRAM key.

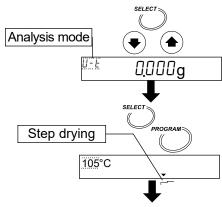

PROG /

PROG 'E

PROG 5

Program number

0,000a

End

0,000a

Set Drying Temperature 1

7. Set 120°C with the ☐ or ☐ key.

Set Time 1


8. Select time 1 with the SELECT key. Set 5.0 minutes with the ☐ or ↑ key.

Set Drying Temperature 2

Select the drying temperature 2 with the SELECT key.
 Set 160°C with the □ or ↑ key.

Set Time 2

10. Select time 2 with the SELECT key. Set 10.0 minutes with the ☐ or ☐ key.

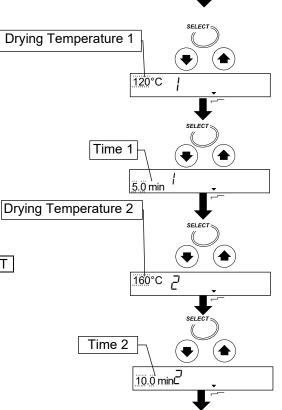

Note: Set "time 2" to the time from the start of measurement. (Refer to the list of Drying Program (Heating Pattern) on page 29.)

Set the Measurement Unit

11. Select measurement unit with the SELECT key. Select the moisture content (based on wet sample) with the ☐ or ☐ key.

Set the Minimum Scale Value of the % Display

12. Select the % display with the SELECT key. Select 0.01 [%] with the ☐ or ☐ key.

Set the Minimum Scale Value of the Gram Display


13. Select the gram display with the SELECT key. Select 0.001 [g] with the □ or ↑ key.

Store the Parameters and Finish the Operation

14. Press the ENTER key to store the new parameters of the measurement program to program number 6. Pressing the key, the weighing mode is automatically displayed.

When PROG 6 is recalled, the settings can be used.

To cancel the new parameters and return to the weighing mode, press the RESET key.

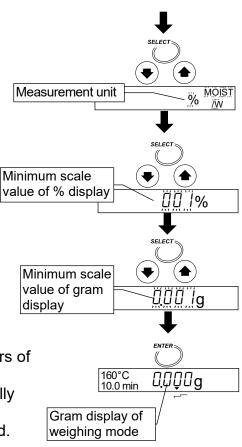



8. Check Function

X

8.1. Self-Check Function

Use the self-check function to check whether there is an error or inaccurate result. During the check, the heater is turned on and the temperature sensor is checked.

Caution

Do not put flammable matter near the analyzer.

Do not put anything on the heater cover.

8.1.1. Operation

- 1. Display the gram unit (of the weighing mode).
- 2. Press and hold the PROGRAM key to display [7].
- 3. Put the breeze break ring, pan support, pan handle and sample pan in order. (Do not put a sample on the pan.)

Close the heater cover.

Press the **ENTER** to start the check.

If [[Lo5E]] is displayed, the heater cover is not closed. When it is closed, the self-check function is started.


4. The check function needs approximately one minute.

Good result... Displays [FH PR55], sounds buzzer and returns to weighing mode automatically.

Error The buzzer sounds and an error code is displayed.

Refer to "14.5. Error Message" for details.

Example: [H no | Error | D | Ht Err

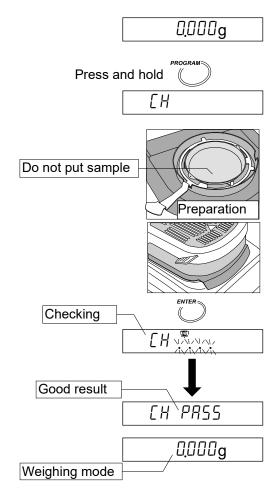



8.2. Test Sample (Sodium Tartrate Dihydrate)

---Test Sample (Sodium tartrate dihydrate, Na₂C₄H₄O₆·2H₂O)---

 Sodium tartrate dihydrate is used to check the accuracy of measurement for the analyzer.

As an ideal substance on theory, sodium tartrate dihydrate, has a moisture content of 15.66% in the molecule. But the moisture content may change depending on storage conditions.

- □ The moisture content of 15.0 to 16.0% is obtained by the method below. (Unit % is based on wet sample)
- Sodium tartrate is contained in food (example : wine). If it may irritate the eyes and nose, wash with water.
- □ The test sample cannot be used repeatedly. Dispose of it as flammable matter.
- □ In case of MS-70 MX-50 and MF-50, test sample is included in these packing list. In case of ML-50, purchase the test sample of accessory.

Caution A hot sample pan may cause an error. Allow the pan to cool before the next test.

Measurement

1. Enter the following parameters.

2. Pre-heating process.


Put a sample pan, instead of a sample, on the pan. Press the START key to heat it. The analyzer temperature becomes equilibrium.

- 3. Press the RESET key to make zero display. Spread the sample as evenly as possible.
- 4. Press the START key to start the measurement. The result is displayed after 8 minutes normally. If the result is between 15.0 to 16.0%, the analyzer works properly.
- 5. Press the following key to complete the measurement.

ENTER key.....Outputs (Prints) the results.

SELECT key.....Returns to the weighing mode.

RESET key.....Returns to the weighing mode and displays zero.

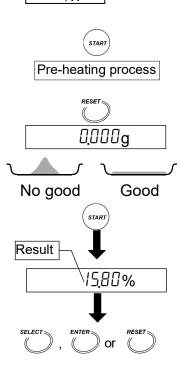



9. Connecting to a Printer

□ The analyzer can be connected to a multi printer (AD-8127) using the RS-232C interface. The results and record adapted to GLP, GMP and ISO can be printed.

GLP: Good Laboratory Practice, GMP: Good Manufacture Practice,

ISO: International Organization for Standardization


- □ The statistical calculation data of the result and the graph data of the change of moisture content per minute can be printed using the function of the AD-8127.
- Use the AD-8127 accessory cable to connect them.

Setting List

Use	Analyzer settings				AD-8127 settings
Ose	PrE	5-d	PUSE	inFa	PRN MODE
Result and measurement program(Excluding statistics calculation)	Ω, Ι	0	1	1,2	DUMP Dump printing
Result with statistical calculation	O, I	0	0,1	0	EXT.KEY External key printing
Trace of change of moisture content per minute	2	0	O, I	0	TIMER Interval printing
Data for GLP, GMP and ISO	0, 1,2	0	0	1,2	DUMP Dump printing

Refer to "13. Function Table" for details about settings.

Read the instruction manual of the printer.

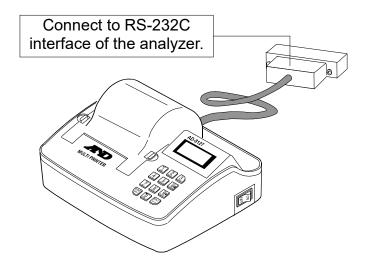

Multi printer (AD-8127)

9.1. Print Samples

9.1.1. Printing the Whole Data at One Time

This example is printed items of "analyzer information", "measurement program", "measurement data" and "signature space" at one time.

Preparation of Parameters

Device	Parameter	Description
	Prt 0 *1	When pressing the ENTER key, the result is outputted.
	Prt 1	Data is outputted after measurement automatically.
Analyzer	5-d 0 *1	Result is outputted only.
	PUSE *1	Approx. two seconds interval in each line.
	ınFa	To print items at one time.
AD-8127	PRN MODE DUMP	Dump print (Received data is printed as it is)

^{*1:} Factory settings

How to Print

Select a parameter to print "Measurement data". Refer to "13. Function Table".

Prե 🛭	When pressing the ENTER key, the result is outputted.
Prt 1	Data is outputted after measurement automatically.

Print Example

A & D MODEL MX-50 S/N P1234567 ID LAB-123 PROGRAM No. 1 MODE STANDARD MID. DRYING STANDARD	Factory Product Serial number ID number. *2 PROG No. Analysis mode. Refer to 9.1.3. Drying program. Refer to 9.1.3.	Analyzer information Measurement program
UNIT MOĪŠĪ/ Ū	Measurement Unit	
INITIAL WEIGHT 5.678 g	} Wet weight	
FINAL WEIGTH 4.567 9	} Dried weight	
RESULT MOIST/ W 19.57 %	} Measurement Result	
ANALYSIS TIME 6.7min	} Analysis time	Measurement data
DATE 2004/09/30 TIME 12:34:56	} Date. Refer to 9.1.3.	
REMARKS	Remarks. Refer to 9.1.3.	
SIGNATURE	Signature. Refer to 9.1.3.	Signature space

^{*2:} ID number can be changed. Refer to "12.1. Identification Number (ID No.)".

9.1.2. Printing Selected Items

This print example is printed multiple measurement data and a suit of items specified from "analyzer information", "measurement program" or "signature space". When the title data is the same, it is economical use.


Preparation of Parameters

Device	Parameter	Description
	Prt 0 *1	When pressing the ENTER key, the result is outputted.
	Prt I	Data is outputted after measurement automatically.
Analyzer	5-4 0 *1	Result is outputted only.
	PUSE I *1	Approx. two seconds interval in each line.
	inFa 2	To print specified item.
AD-8127	PRN MODE	Dump print (Pagaiyad data is printed as it is)
AD-0121	DUMP	Dump print (Received data is printed as it is)

^{*1:} Factory settings

How to Print "Analyzer Information" and "Measurement Program"

- 1. Display the gram unit (of the weighing mode).
- 2. Press and hold the ENTER key.
- 3. Press the SELECT key to select L 15L.
- 4. Press the ENTER key to print them.
- 5. Display the gram unit (of the weighing mode).

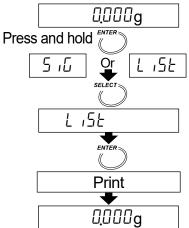


How to Print "Measurement Data"

Select a parameter to print "Measurement data". Refer to "13. Function Table".

Ocicot a pa	Tarrieter to print Measurement data . Refer to 10.1 direction lable .
Prt O	When pressing the ENTER key, the result is outputted.
Prt I	Data is outputted after measurement automatically.

How to Print "Signature Space"

- 1. Display the gram unit (of the weighing mode).
- 2. Press and hold the ENTER key.
- 3. Press the SELECT key to select $5 \cdot \overline{b}$.
- 4. Press the ENTER key to print "signature space".
- 5. Display the gram unit (of the weighing mode).

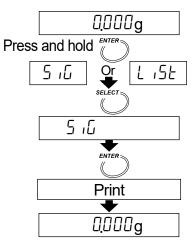


Print Example

A & D MODEL MX-50 S/N P1234567 ID LAB-123 PROGRAM No. 1 MODE STANDARD MID. DRYING STANDARD 160 C UNIT MOIST/ U	Factory Product Serial number ID number. *1 PROG No. Analysis mode. Refer to 9.1.3 Drying program. Refer to 9.1.3 Measurement Unit	Measurement
INITIAL WEIGHT 5.678 9 FINAL WEIGTH	} Wet weight	
4.567 9	} Dried weight	
RESULT MOIST/ W 19.57 %	} Measurement Result	
AMALYSIS TIME 6.7min	} Analysis time	Measurement data
DATE 2004/09/30 TIME 12:34:56	} Date. Refer to 9.1.3.	
REMARKS)	
	Remarks. Refer to 9.1.3.	
INITIAL WEIGHT	Wet weight	
5.791 9 FINAL WEIGTH	Dried weight	
4.680 g RESULT MOIST/ W	} Measurement Result	
19.19 % ANALYSIS TIME	} Analysis time	Measurement data
7.8min DATE 2004/09/30	} Date. Refer to 9.1.3.	
TIME 12:57:12 REMARKS	Date. Refer to 9.1.5.	
: v.m.: :: :: v: v.m.	Remarks. Refer to 9.1.3.	
	,	
INITIAL WEIGHT 5.432 g	} Wet weight	
FINAL WEIGTH 4.321 g	} Dried weight	
RESULT MOIST/ W 20.45 %	} Measurement Result	Measurement data
ANALYSIS TIME 5.4min	} Analysis time	ivieasurement data
DATE 2004/09/30 TIME 13:24:57 REMARKS	} Date. Refer to 9.1.3.	
NETTHEN	Remarks. Refer to 9.1.3.	
SIGNATURE	Signature. Refer to 9.1.3.	Signature space


*1: ID number can be changed. Refer to "12.1. Identification Number (ID No.)".

9.1.3. Explanation for Print Item

"Analyzer information" and "Measurement program"

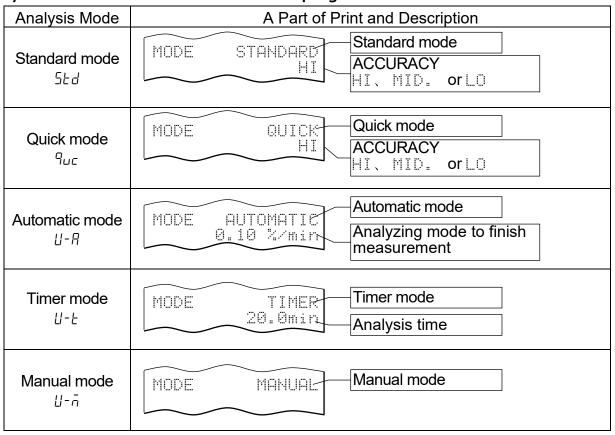

"Heating Pattern"

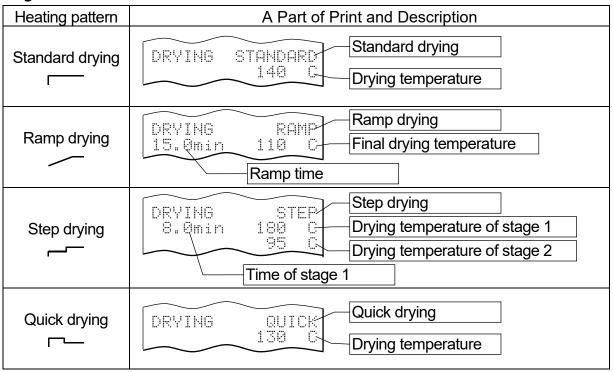

ML-50 can select standard drying and quick drying only.

"Measurement Unit"

Unit	A Part of Print	Formula	Display
Moisture content is based on wet sample mass *1	UNIT MOIST/ W	$\frac{W - D}{W} \times 100$	% MOIST /W
Moisture content (Atro) is based on dried sample mass	UNIT MOIST/ D	$\frac{W-D}{D} \times 100$	% MOIST /D
Dry content	UNIT RATIO D/W	x 100	% RATIO D/W
Ratio *2	UNIT RATIO W/D	W x 100	% RATIO W/D
Gram value	UNIT	_	g

W: Wet sample mass

D: Dried sample mass

*1: Factory settings

*2: When result reaches to 999%, measurement is stopped.

"Date"

It is printed date and time of the built-in clock in the analyzer.


Arrangement of the calendar is the same setting of the built-in clock.

Refer to "5.2. Setting the Clock and Calendar".

If you need to adjust the clock, refer to "5.2. Setting the Clock and Calendar".

"Remarks Space"

For instance: This space can use for a comment about samples.



"Signature Space"






10. Connecting to a Computer

- □ The analyzer can be connected to a personal computer using the RS-232C interface.
- □ The analyzer is the Data Communication Equipment type (DCE). Use a straight-through type cable.

The MS-70 and MX-50 have the following standard accessory cable for RS-232C. If it is necessary to connect a cable to the MF-50 and ML-50, purchase the cable of accessory AX-MX-40. If purchasing the RS-232C cable on the market, check the interface connections and type.

RS-232C Cable Included As A Standard Accessory Of The MS-70 and MX-50 Length 2m, straight-through type for modem

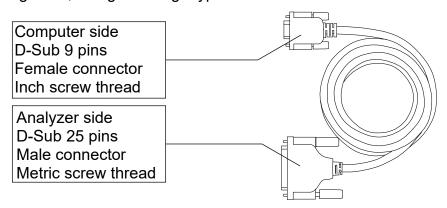

- The MS-70 and MX-50 have the standard accessory software "WinCT-Moisture" for Windows. It has the function to make graphs of the change of moisture content in real time and has an optimum temperature search program that judges heating at an appropriate temperature setting. Refer to "English\Readme.txt" on the CD-ROM for the details.
- "WinCT" can transmit data to a computer and can be used to monitor data and to check the measurement condition. "WinCT" can be downloaded from the A&D website.
- □ There is the accessory software AX-MX-42, "WinCT-Moisture" for Windows.



10.1. RS-232C Serial Interface

RS-232C Serial Interface

□ Transmission system EIA RS-232C

Transmission form Asynchronous, bi-directional, half duplex


Data formatBaud rate2400bps

Data bits 7bits
Parity EVEN
Stop bit 1bit
Code ASCII


Terminator CR LF (CR: 0Dh, LF: 0Ah)

Bit format

RS-232C



Pin Connections



	MX-50 and MF-50 (DCE)		Direction	Computer (DTE)
Pin No.	Signal Name *2	Description	Direction	Signal Name
1	FG	Frame ground	_	FG
2	RXD	Receive data	←	TXD
3	TXD	Transmit data	\rightarrow	RXD
4	RTS	Ready to send *3	←	RTS
5	CTS	Clear to send *3	\rightarrow	CTS
6	DSR	Data set ready	\rightarrow	DSR
7	SG	Signal ground	_	SG
16, 18, 19, 21, 23	Internal use		Do not co	onnect *1
Other	Not used	·		

- *1: Normal DOS/V cables do not use these terminals.
- *2: Signal names of the analyzer side are the same as the DTE side with TXD and RXD reversed.
- *3: RTS and CTS control are not used. CTS output is HI always.

10.2. Output Format

In Case of Format With no Temperature Data Added (Function Table 5-d 1)

- □ The format consists of fifteen characters except the terminator.
- A polarity sign is placed before the data with the leading zeros. If the data is zero, the plus sign is used.
- □ The unit is □□g or □□%.
- □ The position of decimal point and minimum display vary depending on the models.
- Sign of ASCII code

© ODh Carriage return

□ 0Ah Line feed

___ 20h Space

Sample Mass Format (Gram Display)

ST, +0001. 234___gC_RL_F

Header Mass data Unit Terminator

Positive Overload Format (Too heavy weighing, E display)

OL, +9999999E+19CRLF

Header Polarity Overload Terminator

Negative Overload Format (Too light weighing, _-E __ display)

OL, -999999E+19c_RL_F

Header Polarity Overload Terminator

Moisture Content (during weighing or after weighing)

In case of the MS-70

ST, +0012. 345___%CRLF

Header Moisture content Unit Terminator

In case of the MX-50 or MF-50

ST, +00023. 45 ___% C_R L_F

Header Moisture content Unit Terminator

In case of the ML-50

ST, +000123. 4 _ _ % CR LF


Header Moisture content Unit Terminator

In Case of Format With Temperature Data Added (Function Table 5-d 1)


□ The first 3 figures are the temperature data.

The format consists of nineteen characters except the terminator.


In case of the MS-70



In case of the MX-50 or MF-50



In case of the ML-50



10.3. Command

□ The analyzer can be controlled by the following commands from the computer. Add a terminator ¬□ (ODh, OAh) to each command.

Command	Description
Q	Outputs the current data.
SIR	Outputs data continuously
С	Stops data output by SIR command.
QM	Outputs the data during measurement. (Available only during measurement)
START	Same as the START key
STOP	Same as the STOP key
RESET	Same as the RESET key
ENTER	Same as the ENTER key
SELECT	Same as the SELECT key
DOWN	Same as the ↓ key
UP	Same as the ↑ key
PROGRAM	Same as the PROGRAM key



11. Data Memory Function

The data memory function automatically stores each result when finishing a measurement.


	MS-70 / MX-50	MF-50	ML-50
Maximum number	100 data	50 data	30 data

- The stored data can be output to a printer at one time and can be output to a computer using RsCom and Rskey that are Windows applications stored in the CD-ROM of WinCT-Moisture at one time.
- The stored data can be deleted at one time.
- The function can select either storing each result or not at dR + R of the function table.

- When using the data memory function, MEM is displayed.
- □ When FULL is displayed, the function cannot store the next data. The function can store new data after deleting the stored data.

Caution


- □ When pressing the STOP key during a measurement except manual mode, the result is not stored.
- □ Set dRtR / before measurement, if it is necessary to store each result with data memory function.



11.1. Preparation

This example selects "store result" at dRtR of the function table.

- 1. Display the gram unit (of the weighing mode).
- 2. Press and hold the SELECT key to enter the function table.
- 3. Press the SELECT key to display dRLR.
- 3. Press the SELECT key several times and press the ☐ or ☐ key to display ☐ dRER ☐.
- Press the ENTER key to store the new settings.
 Press the RESET key to return to the weighing mode.
 MEM is displayed when the memory function is effective.

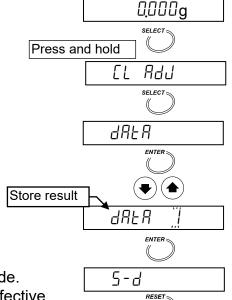


MEM_C

0.000g

11.2. Outputting All Data at One Time

1. Display the gram unit (of the weighing mode). 0000a Number of data Press and hold (2. Press and hold the ENTER key to display out. **JRER** out 3. Press the ENTER key to display out no. **JRFB** aut 4. Press the ↓ or ↑ key to display [out [ij]]. 48F8 out 5. Press the ENTER key to output the data in order. Data is output to the peripheral equipment (printer or dRER out Go computer) connected to the RS-232C interface. Output data in order MEM →30 out Ga. End 6. When output is finished, *ξnd* is displayed. [Lr 7. Press the RESET key to return to the weighing mode. 0,000g

11.3. Deleting All Data at One Time

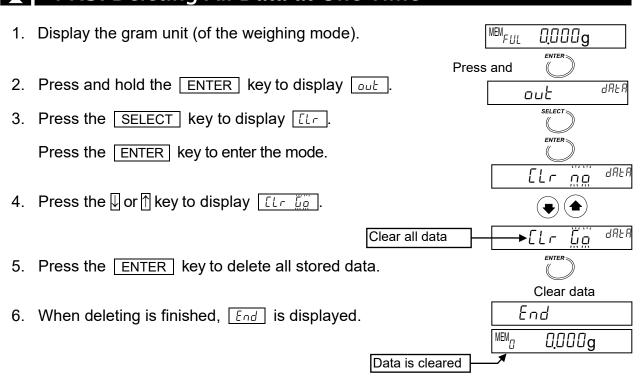



12. Calibration

- The moisture content is calculated with a ratio of wet weight and dried weight. Therefore, the absolute value of weighing does not influence the calculation of the moisture content, but it is necessary to get precise weighing for GLP, GMP and ISO. Use a 20g mass or a 50g mass to calibrate the weighing sensor.
- When calibrating the weighing sensor, you can output the calibration report adapted to GLP, GMP and ISO.
- □ There is a certified temperature calibrator (accessory AX-MX-43, only for MS-70 and MX-50) to calibrate the pan temperature for precise temperature control.
- When calibrating the temperature, you can output the calibration report adapted to GLP, GMP and ISO.
- □ The analyzer can store an ID number to be used in the calibration report. The number can be used for management and maintenance of the analyzer

12.1. Identification Number (ID No.)

□ The ID number consists of the following seven characters.

The 12 Halling College of the fellowing cover characterer																	
Characters	0	1	2	თ	4	5	6	7	8	9	S	pac	е	-(hyp	her	า)
Display		-	2	Π	4	5	5	Γ-	8	9					-	-	
Characters	Α	В	О	D	Е	F	G	Η	I	٦	Κ	L	М	Ν	0	Ρ	Ø
Display	R	Ь	Γ	Ъ	Ε	F	Г	Н	1	IJ	ħ	L	Ō	Π	٥	Р	9
Characters	R	S	Τ	U	V	W	Χ	Υ	Ζ								

Display r 5 E U ū P II Y

12.1.1. Setting the ID Number

1. Turn on the analyzer.

The gram unit (of weighing mode) is displayed.

- 2. Press and hold the SELECT key to enter the function table. Then [[RdJ] is displayed.
- 3. Press the SELECT key to display d.
- 4. Press the ENTER key.
- 5. Set the ID number using the following keys.


Example: L86 - 123

SELECT key Selects a figure.

□, key.....Selects a value for the figure.

ENTER key.....Stores the ID No. and proceeds to step 6.

6. Press the RESET key to return to the weighing mode.

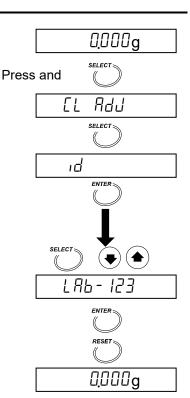

12.2. Calibrating the Weighting Sensor

- A standard mass of 20g or 50g can be used for the calibration
- □ A 20g standard mass (AX-MX-41 or AD1603-20F1) is recommend.

Caution


- Avoid vibration and drafts that affect the calibration. If affected, the analyzer may be unable to calibrate the weighing sensor.
- Use a 20g mass for the calibration, because the height between the weighing pan and glass-housing is 26 mm. If a tall mass is used, open the glass-housing and avoid external influence.

12.2.1. Operation

- 1. Display the gram unit (of the weighing mode).
- 2. Install the weighing pan, pan support and pan handle. Close the heater cover.
- 3. Press and hold the PROGRAM key to display [[H]].
- 4. Press the SELECT key to display [FRL].
- 5. Press the ENTER key to display [FRL 0].
- 6. If 20g mass is used,Press the ENTER key.
 Proceed to step 8.
 If 50g mass is used,Press the SELECT key.
 Proceed to step 7.
- 7. Press the or key to select 50.000g. Press the ENTER key to store it.
- 8. When TRL II is displayed, press the ENTER key to input "Data to display ZERO". The standard mass value is displayed (Example: 20g).
- 10. Remove the mass to return to the weighing mode

 If the report for GLP, GMP and ISO is to be output (Refer to page 62), GLP is displayed.

 The output condition for the report is selected in

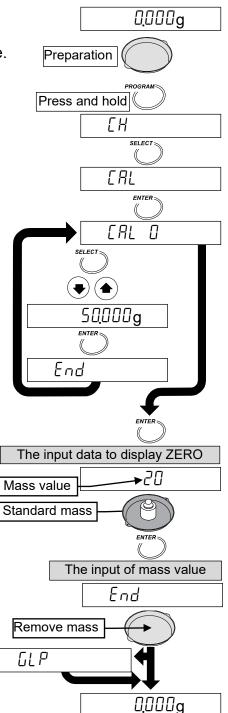


the function table.

Calibration Report Example for the Weighing Sensor Adapted to GLP, GMP and ISO

Preset the following parameters to print data to AD-8127


Device	Param	eter	Description
	Interval PUSE		Approx. two seconds interval in each line.
Analyzer	Output format adapted to GLP, GMP and ISO	info or info 2	Calibration report is printed when the weighing sensor or the drying temperature is calibrated.
AD-8127	Printing mode	PRN MODE DUMP	Dump print (Received data is printed as it is)

*1: Factory settings

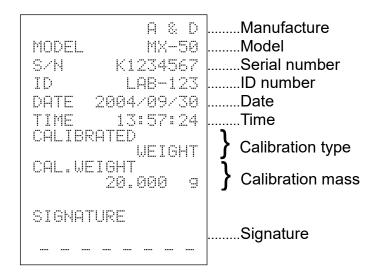

12.3. Calibrating Drying Temperature (for MS-70 and MX-50)

- The temperature calibrator (accessory AX-MX-43) adjusts the drying temperature on the pan. Put the sensor on the pan and input measurement data at 100°C and 160°C.
- Each adjustment needs fifteen minutes. The buzzer sounds at the end.
- □ <u>E-UP</u> is displayed after no adjustment for five minutes during the operation and calibration is stopped. Press any key to return to weighing mode.
- □ Refer to the instruction manual of the certified temperature calibrator (accessory AX-MX-43).

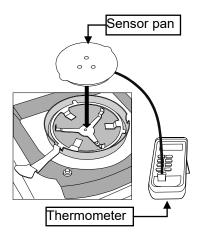

12.3.1. Operation

- 1. Replace the weighing pan with the sensor pan of the temperature calibrator.
- 2. Curve the sensor wire so it does not touch the heater cover and glass-housing when closing heater cover.


Level the sensor pan.


Do not leave a gap between the pan support and the sensor.

Level the sensor pan.

Curve the sensor wire so as not to touch heater cover.


- 3. Turn on the analyzer.
 Display the gram unit (of the weighing mode)
- 4. Press and hold the PROGRAM key
- 5. Press the SELECT key to display \(\frac{1}{2} \in RL\).
- 6. Press the ENTER key.
- 7. Press the START key to start the 100°C measurement.
- 8. After fifteen minutes, the buzzer sounds and blinks ☐☐☐○C . Adjust the blinking value to the thermometer value using the ☐ or ☐ key. (Example: 97°C)
- 9. Press the ENTER key to store the new data and to start the 160°C measurement.

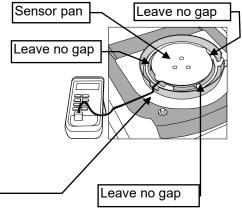

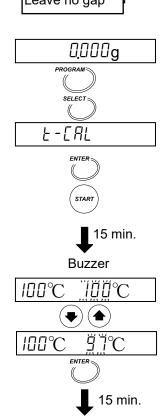

- 10. After fifteen minutes, the buzzer sounds and the display blinks ☐60°C. Adjust the blinking value to the thermometer value using the ☐ or ☐ key. (Example: 162°C)
- 11. Press the **ENTER** key to store the new data, to finish the adjustment and to return to the weighing mode.

If the report for GLP, GMP and ISO is output, <u>GLP</u> is displayed. Output condition is selected in the function table.

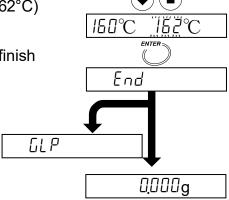

160°C

Buzzer

When the heater cover is opened during measurement or the STOP key is pressed, calibration is stopped and the analyzer displays the weighing mode.




Calibration Report Example for Temperature Sensor Adapted to GLP, GMP and ISO

Preset the following parameters to print data to AD-8127

Device	Param	eter	Description
	Interval	PUSE I *1	Approx. two seconds interval in each line.
Analyzer	Output format adapted to GLP, GMP and ISO	inFa or inFa 2	Calibration report is printed when the weighing sensor or the drying temperature is calibrated.
AD-8127	Printing mode	PRN DUMP MODE	Dump print (Received data is printed as it is)

*1: Factory settings

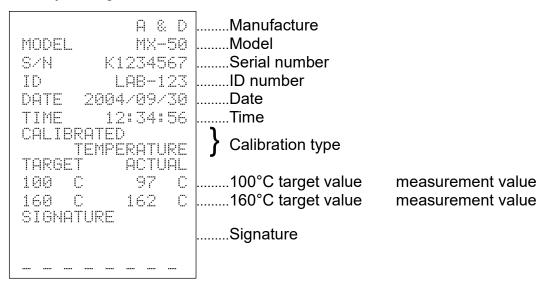




13. Function Table

The function table can store the following parameters to control the analyzer.

Details of the Function Table

Item and Display Symbol			Param- eter Description						
Clock	Set	Set date and time for the built-in clock.							
CIUCK	CL A99	Ref	er to	5.2. Setting the	Clock and Calendar".				
Decimal point	dP	0	*1	Dot " . "	Select decimal point o	of data			
Decimal point	U1	1		Comma " , "	Select decimal point of	n data.			
		0	*1	Key mode	Data is output by the	ENTER key			
Data output	PrE	1		Auto print mode	Data is output after m	easurement.			
mode	,,,,	2		Stream mode	Data is output continumeasurement.	ously during			
Data memory	dRER		*1	Not used.					
function	וווניו	1		Data is stored at each measurement					
Form selection 5-d			*1	Moisture content is output.					
FOITH SELECTION	ט נ	1	/ Moisture content and temperature are output						
Interval	PUSE	<i>[</i>]		Continuous output					
IIILEIVAI	1 0 3 6	1	*1	1 Output with approx. two seconds interval in each lir					
		0	*1	Not used					
Output format adapted to GLP, GMP and	ınFa	1		To output (print) information", "me "measurement da space" at one time	Output of calibration				
ISO		2		To output (print) items specified from report "analyzer information", "measurement program" and "signature space". *4					
ID number	ıd	Set	Set ID number. Used for the calibration report.						
Factory settings	ELr	Res	esets the analyzer to the factory settings.						

- *1: Factory settings
- *2: Use a computer because the AD-8121B printer cannot print this correctly. When RsTemp or RsFig (included in the software "WinCT-Moisture", standard accessory for the MS-70 and MX-50) is used, the results and temperature can be displayed by changing axis settings of RsFig.
- *3: Refer to "9.1.1. Printing the Whole Data at One Time".
- *4: Refer to "9.1.2. Printing Selected Items".
- *5: Calibration report is outputted when the weighing sensor or the drying temperature is calibrated.

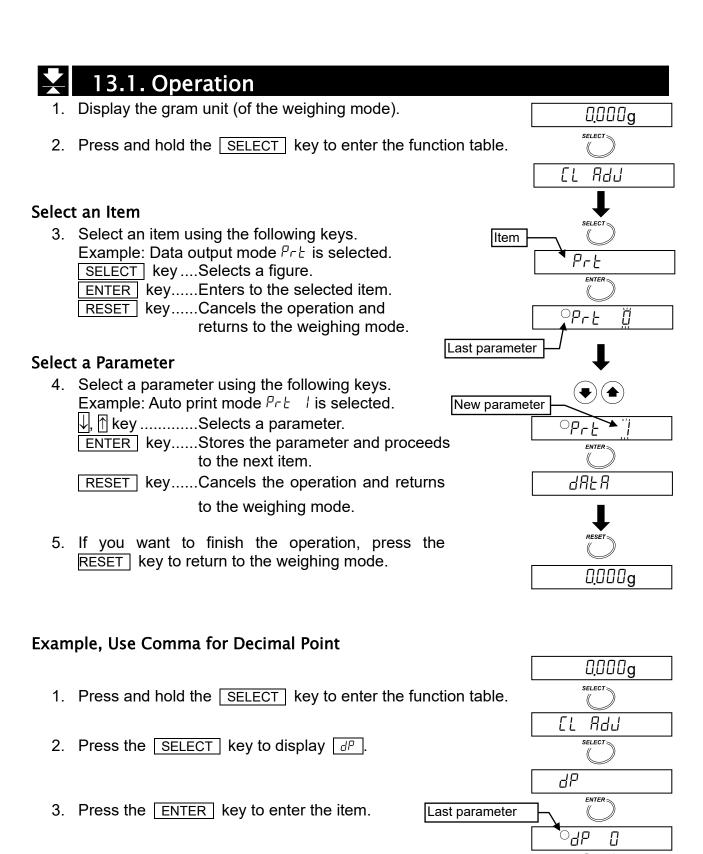

mode.

4. Press the ↓ or ↑ key to display de ∴ .

5. Press the ENTER key to store the new parameter.

6. Press the RESET key to return to the weighing

0<u>.</u>000g

d٥


PrE

New parameter



14. Maintenance


- Turn off the power switch and remove power cord during maintenance.
- ON OFF
- Cool down all parts of the analyzer before maintenance.
- Pan support, sample pan and breeze break ring can be removed.
- Clean the analyzer with a lint free cloth that is moistened with warm water and a mild detergent.
- Do not use organic solvents to clean the analyzer.
- Dry the parts and reassemble them. Refer to "2. Precautions" and "5.1. Installing the Analyzer".
- Use the original packing material and box for transportation.

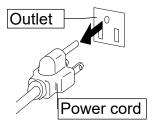


Example

14.1. Cleaning the Heater Unit

- Clean the glass-housing when it is stained (not clear) to maintain the drying performance.
- The glass-housing can be removed by removing two screws.
- Remove fingerprints from the halogen lamp to keep its life.
- Do not touch to reflective surface of the metal reflector.
 If the surface is touched, it may be the cause of a drying temperature error.
- Do not touch the temperature sensor that is at the side of halogen lamp. If the surface is touched, it may be the cause of a drying temperature error.

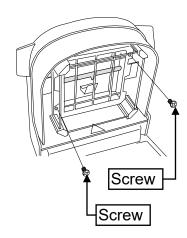

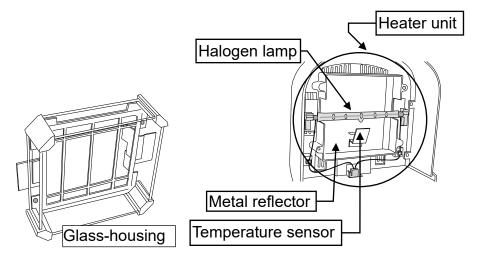

14.2. Replacing the Halogen Lamp

 Replace the halogen lamp, when the drying time is excessive or the lamp is defective. Use the halogen lamp of accessory AX-MX-34-120V or AX-MX-34-240V that is adapted to your local voltage. The life of the halogen lamp is approximately 5000 hours.

Caution


- Remove power cord before replacement. If the power cord is not removed during lamp replacement, it may cause receiving an electric shock.
- Read the power supply voltage label on the back of the heater cover and confirm that the rated voltage of the halogen lamp is correct for your power supply voltage.

Voltage Label	The Rated Voltage of the Halogen Lamp	Accessory number
100 – 120 V	AC 120 V	AX-MX-34-120V
200 – 240 V	AC 240 V	AX-MX-34-240V

- Do not drop, throw or crack the halogen lamp. Broken glass may cause an injury.
- Clean the surface of the halogen lamp. If there is a stain or fingerprint, it may shorten life of the halogen lamp. Do not touch the lamp directly.
- Dispose of a used halogen lamp that keeps its shape. If it is broken, glass may spread and cause injury.
- We recommend that you replace the halogen lamp, when it exceeds the rated life.
- Affix the lamp wire to the hook so that the lamp wire does not touch the glass-housing and heater cover.
- 1. Turn off the power switch and remove power cord.

There is downward projection. 2. Check rated voltage of the halogen

- lamp that is printed around the holder.
- 3. Check that the lamp is cool.
- 4. Remove the two screws holding the glass-housing.
- 5. Remove halogen lamp.
- 6. Install the new halogen lamp so that there is downward projection of the heat and light.
- 7. Affix the lamp wire to the hook.
- 8. Affix the glass-housing with the two screws. Do not pinch the wire between the glass-housing and lid.

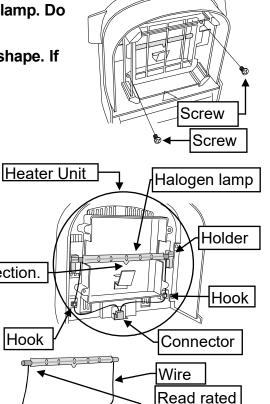

voltage.

Glass-housing

Hook

14.3. Factory Settings

This function can set the following parameters to factory settings.

- All measurement programs
- All results stored in memory function.
- All parameters of the function table
- □ ID number is reset to 0000000.
- Order of calendar and date.


14.3.1. Operation

- 1. Turn on the analyzer. The gram unit (of the weighing mode) is displayed.
- 2. Press and hold the SELECT key to enter the function table.
- 3. Press the SELECT key to display [[Lr].
- 4. Press the ENTER key to enter the item.
- 5. Press the ↓ or ↑ key to display [[Lr [[g]]]].

Caution

If pressing the ENTER key with [[Lr ng] and pressing the **RESET** key, operation is canceled.

- 6. Press the ENTER key to reset. And End is displayed.
- 7. Press the RESET key to return to the weighing mode.

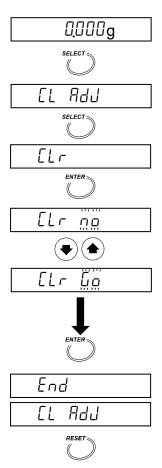

0.000g

14.4. Troubleshooting

1. In the Case That Proper Results Are not Obtained.

- Use the self-check function. Refer to "8.1. Self-Check Function."
- Check repeatability. (Weigh the same mass several times in the weighing mode.) A taller mass may touch the glass-housing. Use a short mass if possible. If a tall 50g mass is used, open the heater cover and avoid external influence.
- □ The height from sample pan to glass-housing is 26 mm.
- Check whether the test sample can be measured correctly.
- Avoid the breeze from an air conditioner and vibration.




 Check measurement procedure and pre-heating process. Refer to "5.3. Proper Operation for Precision Measurement".



- It requires six seconds to light the halogen lamp using the START key.
- □ When the heater cover is opened, power is not supplied to the halogen lamp.
- □ When an overheat has occurred, power is not supplied to the halogen lamp until the halogen lamp becomes cool.
- Check the rated voltage of the halogen lamp that is printed around the holder.
- Read the power supply voltage label on the back of the heater cover and confirm that the rated voltage of the halogen lamp is correct for your power supply voltage.


Voltage Label	Power Supply Voltage	The Rated Voltage of the Halogen Lamp	Accessory number
100 - 120 V	AC 100 V to AC 120 V	AC 120 V	AX-MX-34-120V
200V - 240 V	AC 200V to AC 240 V	AC 240 V	AX-MX-34-240V

- Is a fuse blown? Check the fuses after removing the power cord. Check the rated value and put new fuses into the correct holders.
- Do you measure a lower drying temperature after a high drying temperature? If the lamp is hotter than the drying temperature, the measurement cannot be started.
- Check that the sample pan is cool.
- Other cases, the halogen lamp may be defective. Replace with a new halogen lamp. Refer to "14.2. Replacing the Halogen Lamp".

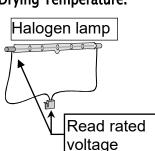

Maximum height

of mass is 26 mm.

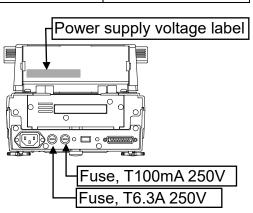

\mathbf{X}

14.5. Error Message

[H no

Internal Error

An internal error indicated by the result of the self-check function. If repair is needed, contact the local A&D dealer.

[L PF

Clock Battery Error

Press any key and input the date and time. Refer to "5.2. Setting the Clock and Calendar".

[L Err

Clock Error

Contact the local A&D dealer to repair the analyzer.

CLo5E

Heater Cover Error

The heater cover is opened when starting self-check function. If it is closed, the self-check function is started.

ErrarO

Internal Error

Turn the power switch off and then on . Check the frequency of the power supply. Contact the local A&D dealer to repair the analyzer, if the error is not cleared.

Error3

IC Error

Error8 Error9 Contact the local A&D dealer to repair the analyzer.

HŁ Err

Temperature Control Error

Contact the local A&D dealer to repair the analyzer, if an error is not cleared when turning the power switch off for more than a half hour and rechecking it.

Ł-UP

Time Error at Temperature Calibration

There is no key operation for five minutes during temperature calibration. If pressing any key, the weighing mode is displayed.

Е

Positive Overload, Overweight

The sample has exceeded the weighing capacity.

If the weighing sample pan is empty and this error is displayed, contact the local A&D dealer to repair the analyzer.

- E

Negative Overload, Sample Pan Error

The weight value is too light. Check the pan, pan support and press the RESET key. Calibrate the weighing sensor.

If an error can be not cleared, contact the local A&D dealer to repair the analyzer.

CAL E

Unsuitable Calibration mass (Positive Error)

The calibration mass is too heavy. Confirm that anything does not touch to the pan, the calibration mass does not touch to the glass-housing of the heater cover and the calibration mass value is correct. When pressing any key or waiting for 15 seconds, the weighing mode is automatically displayed.

-CRL E

Unsuitable Calibration mass (Negative Error)

The calibration mass is too light. Confirm that anything does not touch to the pan and the calibration mass value is correct. When pressing any key or waiting for 15 seconds, the weighing mode is automatically displayed.

MEM

Full Memory

FUL

The number of results stored in memory has reached the upper limit. Clear the data to store the new results. Refer to "11. Data Memory Function".



15. Specifications

	MS-70	MX-50	MF-50	ML-50			
Measurement method	400 W	halogen lamp, the	ermogravimetric a	analysis			
Drying temperature range at sample pan (Increments)	30°C to 200°C (1°C)		50°C to 200°C (1°C)				
Heating pattern		ard drying, Ramp o drying, Quick dr		Standard drying, Quick drying			
Temperature calibration		y AX-MX-43	_	_			
Sample weight range	0.1 g to 71 g		0.1 g to 51 g				
Accuracy: Repeatability	of measurement,	(Standard deviation	on)				
Moisture content *1			T				
over 5 g sample	0.01 %	0.02 %	0.05 %	0.1 %			
over 1 g sample	0.05 %	0.1 %	0.2 %	0.5 %			
Weighing mode	0.0005 g	0.001 g	0.002 g	0.005 g			
Minimum reading							
Moisture content	0.001 %, 0.01 %, 0.1 %	0.01 %, 0.1 %	0.05%, 0.1 %, 1 %	0.1%, 1 %			
Weighing mode	0.0001 g	0.001g	0.002g	0.002g			
Measurement programs							
Standard mode	ACCURACY and termination value	d % display. Wher	nlue is automatica n drying rate reach s automatically co ep drying	hes the			
စု Quick mode	Sample weight and termination value is automatically set with ACCURACY and % display. When drying rate reaches the termination value, measurement is automatically completed. (*2) Quick drying						
Automatic mode	measurement is	e is less than pres automatically cor Ramp drying, Ste		ue, Standard drying			
Timer mode	After heating for		time, measureme				
		Ramp drying, Ste		Standard drying			
Manual mode	the result is deci-	ded.	e, measurement i	· ·			
	Moisture content		ep arying	Standard drying			
Measurement unit	Moisture content (Dry-base, Atro) Dry content Ratio						
	Weight (g)						
Number of memory		sets	10 sets	5 sets			
Data memory function	100 re	esults	50 results	30 results			
Communication function	RS-232C serial interface						
Operation environment	5°C to 40°C (41°F to 104°F), 85%RH or less (no condensation)						
Sample pan	φ85 mm						


^{*1:} After preheating the analyzer, the data can be obtained with approximately 5 g test sample (Sodium tartrate dihydrate) in standard mode (MID.), standard drying, 160 °C

^{*2:} When change of moisture content per minute reaches the preset termination value, the measurement is completed.

	MS-70	MX-50	MF-50	ML-50					
Installation environment		Indoor use only							
Altitude		Up to 2	,000 m						
Overvoltage category		I	I						
Pollution degree			2						
Power source,	A	C100V to 120V (-	+10%, -15%) 3A c	or					
Maximum current (r.m.s), Maximum consumption	A	C200V to 240V (- c or 60Hz, Approxi	+10%, -15%) 1.5/	Α,					
	50Hz	or 60Hz, Approxi	mately 400W	*3					
External dimensions		(D) x 173(H)mm,							
Mass (Net weight)		oroximately 6kg (ex							
Accessories	O : Standard ac		: Accessory by y						
Pan support	0	0	0	0					
Breeze break ring	0	0	0	0					
Display cover	0	0	0	0					
Power cord *3	0	0	0	0					
Spare fuse T100mA 250V	0	0	0	0					
Spare fuse T6.3A 250V	0	0	0	0					
Instruction manual	0	0	0	0					
Dust cover	0	0	0	_					
Test sample	0	0	0	_					
Glass fiber sheets	0	0	0	_					
Spoon	0	0	0	_					
Tweezers	0	0	0	_					
RS-232C serial interface cable	0	0	_	_					
Sample pan	20	20	20	10					
Pan handle	2	2	2	1					
Disposable aluminum foil pan	100	100	100	100					
CD-ROM *4	WinCT-Moisture	WinCT-Moisture							

^{*3:} Please confirm that this analyzer is correct for your local voltage and receptacle type and the power cord.
*4: Application software for Windows.

. Dimensions

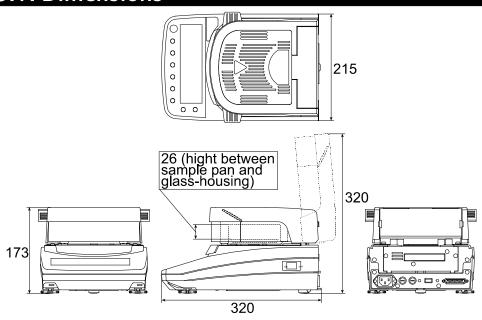



15.2. Accessories and Options

Accessories

Name	Order number
Disposable aluminum foil pan (φ83 mm, 100 pcs)	AX-MX-30
Sample pan (∮85 mm, 100 pcs)	AX-MX-31
Glass fiber sheet, φ70 mm, (Filter paper, 100 sheets)	A V M V 22 1
Use for high surface tension liquid sample.	AX-MX-32-1
Glass fiber sheet, ∳78 mm, (Glass paper, 100 sheets)	AX-MX-32-2
The same sheet as accessory. Use for liquid sample.	AX-IVIX-32-2
Test sample (Sodium tartrate dihydrate, 30gx12 pcs)	AX-MX-33
Halogen lamp for AC 100V to 120 V	AX-MX-34-120V
Halogen lamp for AC 200V to 240 V	AX-MX-34-240V
Pan handle (2 pcs)	AX-MX-35
Tweezers (2 pcs)	AX-MX-36
Spoon (2 pcs)	AX-MX-37
Display cover (5 pcs)	AX-MX-38
Dust cover	AX-MX-39
RS-232C cable (2m, 25 pins - 9 pins)	AX-MX-40
Calibration mass (20g, equivalent to OIML class F1)	AX-MX-41
WinCT-Moisture (CD-ROM: Application software for Windows)	AX-MX-42
Certified Temperature calibrator (only for MS-70 and MX-50)	AX-MX-43

Options

AD-1683: DC Static Eliminator

- Used to minimize weighing errors due to static electricity on the material.
- The ions generated produce no breeze and are effective over a long distance. Suitable for weighing powders accurately.

AD-1684: Electrostatic Field Meter

Measures the amount of the static charge on the sample, tare or peripheral equipment and displays the result.
 If those are found to be charged, discharge them using the AD-1683 DC static eliminator.

AD-1687: Weighing Environment Logger

- A data logger equipped with 4 sensors for temperature, humidity, barometric pressure and vibration that can measure and store environmental data.
- When connected to the RS-232C interface of the analyzer, the AD-1687 can store environmental data along with weighing data. Therefore, it is possible to store data in an environment where a computer cannot be used.

The stored data can be read to a personal computer using USB.

As the AD-1687 is recognized as USB memory, special software is not required to read the data.

AD-1688: Data Logger

When connected to the RS-232C interface of the analyzer, the AD-1688 can store the data in an environment where a personal computer cannot be used. The stored data can be read to a personal computer using USB. As the AD-1688 is recognized as USB memory, special software is not required to read the data.

AD-1689: Tweezers for Calibration Weight

Used when calibrating the analyzer using an external weight.

AD-8127: Printer

- Multi Printer
- Statistical function, clock and calendar function, interval print function, graphic print function, dump print mode
- □ 7 x 9 dots, 24 characters per line
- Printer paper (AX-PP137-S, 57.5 (W) x 30 (L) mm, ø65 mm)

AD-8526: Ethernet Converter

- Connects the RS-232C interface of the analyzer to the Ethernet (LAN) port of a computer that is not equipped with an RS-232C interface.
- Can manage weighing data using a network.
- Includes the communication software "WinCT-Plus".

AD-8527: Quick USB Adapter

- Can transmit weighing data to a personal computer in real time when connected to the RS-232C interface of the analyzer and to the computer using USB.
- Data transmission to any application such as Excel and Word.
- No driver software required.
- Complying with IP65 (with the casing cover)

AX-USB-25P-EX: USB Converter

- Adds a COM port to a personal computer.
- Enables bi-directional communication between the personal computer and the analyzer when a USB driver is installed.
- Can use serial communication software such as WinCT on a personal computer without COM ports.
- An RS-232C cable is provided to connect the USB converter to the analyzer.

AD-1603-20F1: Calibration Weights

20g OIML class F1

MEMO

MEMO

	_
	_
	_
	_
	_





A&D Company, Limited

3-23-14 Higashi-Ikebukuro, Toshima-ku, Tokyo 170-0013, JAPAN Telephone: [81] (3) 5391-6132 Fax: [81] (3) 5391-1566

A&D ENGINEERING, INC.

47747 Warm Springs Blvd, Fremont, California 94539, U.S.A.

Tel: [1] (800) 726-3364 Weighing Support: [1] (888) 726-5931 Inspection Support: [1] (855) 332-8815

A&D INSTRUMENTS LIMITED

Unit 24/26 Blacklands Way, Abingdon Business Park, Abingdon, Oxfordshire OX14 1DY United Kingdom

Telephone: [44] (1235) 550420 Fax: [44] (1235) 550485

A&D AUSTRALASIA PTY LTD

32 Dew Street, Thebarton, South Australia 5031, AUSTRALIA Telephone: [61] (8) 8301-8100 Fax: [61] (8) 8352-7409

A&D KOREA Limited 한국에이.엔.디(주)

서울특별시 영등포구 국제금융로6길33 (여의도동) 맨하탄빌딩 817 우편 번호 07331

(817, Manhattan Bldg., 33. Gukjegeumyung-ro 6-qil, Yeongdeungpo-gu, Seoul, 07331 Korea)

전화: [82] (2) 780-4101 팩스: [82] (2) 782-4264

OOO A&D RUS OOO "ЭЙ энд ДИ РУС"

Почтовый адрес:121357, Российская Федерация, г.Москва, ул. Верейская, дом 17

Юридический адрес: 117545, Российская Федерация, г. Москва, ул. Дорожная, д.3, корп.6, комн. 8б

(121357, Russian Federation, Moscow, Vereyskaya Street 17) тел.: [7] (495) 937-33-44 факс: [7] (495) 937-55-66

A&D Instruments India Private Limited

ऐ&डी इन्स्ट्रयमेन्ट्स इण्डिया प्रा० लिमिटेड

D-48, उद्योग विहार , फेस -5, गुड़गांव - 122016, हरियाणा , भारत

(D-48, Udyog Vihar, Phase-V, Gurgaon - 122016, Haryana, India) फोन : [91] (124) 4715555 फैक्स : [91] (124) 4715599

A&D SCIENTECH TAIWAN LIMITED. A&D台灣分公司 艾安得股份有限公司

台湾台北市中正區青島東路5號4樓

(4F No.5 Ching Tao East Road, Taipei Taiwan R.O.C.)

Tel: [886](02) 2322-4722 Fax: [886](02) 2392-1794

A&D INSTRUMENTS (THAILAND) LIMITED บริษัท เอ แอนด์ ดี อินสทรูเม้นท์ (ไทยแลนด์) จำกัด 168/16 หมูที่ 1 ตำบลรังสิต อำเภอธัญบุรี จังหวัดปทุมธานี 12110 ประเทศไทย

(168/16 Moo 1, Rangsit, Thanyaburi, Pathumthani 12110 Thailand)

Tel: [66] 20038911